



PHILIPPINE NOTICES TO MARINERS

Monthly Edition No.: 2025-05
31 May 2025

Notices Nos.: 012 to 017

CONTENTS

- | | |
|-----|---------------------------------|
| I | Index of Charts Affected |
| II | Chart Corrections |
| III | Temporary & Preliminary Notices |
| IV | List of Lights Corrections |
| V | Coast Pilot Corrections |
| VI | Navigational Warnings |
| VII | Publication Notices |
-

Published by
National Mapping and Resource Information Authority
Lawton Avenue, Fort Bonifacio, Taguig City

ISSN 3028 -1067

Tel: (632) 8241-3494 to 98
Email: csu.hb@namria.gov.ph (NAMRIA Client Service Unit)
Website: www.namria.gov.ph

MARITIME AFFAIRS DIVISION
Maritime Spatial and Safety Information Service
Editorial Board 2025

Editor-In-Chief:
LCDR MAY ANNE L JAVIER, NAMRIA

Supervising Editor:
P/ENS ANA LIANE Z ZAUSA, NAMRIA

Verifier:
Hermielyn C. Sagucio

Compilers:
SN3 Anjanette A Crucis, NAMRIA
SN3 Rhean Mark A Monilla, NAMRIA
SN3 Samuel F Soriano, NAMRIA
SN3 Krishna O Lee, NAMRIA
Teresita B. Sarmiento

THE PHILIPPINE NOTICES TO MARINERS is a monthly publication produced by the National Mapping and Resource Information Authority (NAMRIA). It contains the recent chart corrections, updates to nautical publications, and other information that is vital for the safety of navigation on Philippine waters.

Copies in digital format may be obtained or by downloading at the NAMRIA website: <https://namria.gov.ph/downloads.aspx#publications> or by sending a request through the email address ph-msi@namria.gov.ph.

Organized chart corrections, cumulative and summary list of chart corrections as well as online hydrographic notes are also available through the **Online Maritime Safety Information System (OMSIS)**, <https://isportal.namria.gov.ph/OMSIS/Default.aspx>.

Masters of vessels and other concerned parties are requested to advance any report of dangers to navigation and other information affecting Philippine Charts and Coast Pilots, which may come to their attention, to the **Director, Hydrography Branch**. If such information warrants urgent attention, for instance, the non-existence of aids to navigation, failure of light beacons or similar structures, or discovery of new shoals, all concerned are requested to contact NAMRIA directly through the following portals:


Mail	NAMRIA Hydrography Branch, 421 Barraca St San Nicolas, 1010 Manila, Philippines
E-mail	ph-msi@namria.gov.ph
Landline	(+632) 8245-0295
Online	https://namria.gov.ph/omsis/HNNote10.aspx .

Active navigational warnings are accessible at <https://staging.geoportal.gov.ph/nwapp/>

EXPLANATORY NOTES

1. The Philippine Notices to Mariners is divided into the following sections:

Section I. Index of Charts Affected – Contains the list of all nautical charts that have been affected by Notices to Mariners and the Notice Numbers that have affected them.

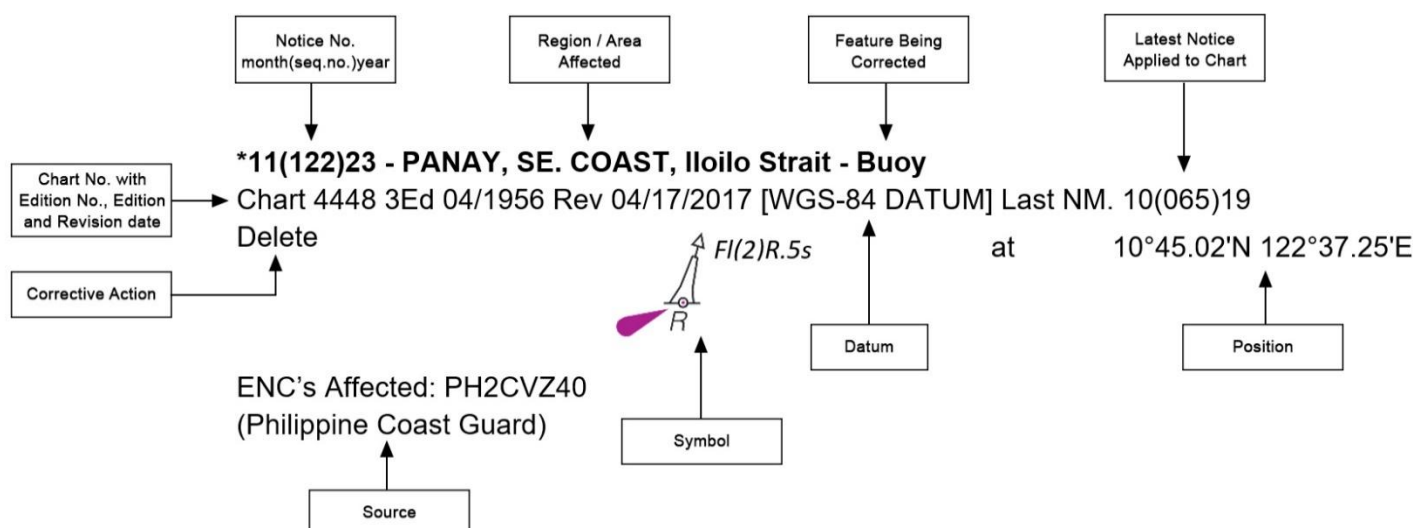

Section II. Chart Corrections - Contains corrections to nautical charts in sequential numbers with the indication of the month and year of its issuance. The illustration below describes the elements that comprise a typical notice:

Notice No. preceded by an asterisk “*” indicates that the information is based upon the original Philippine source.

Section III. Temporary & Preliminary Notices – Contains Notices to Mariners that temporarily affect the nautical charts or have preliminary information that is subject to further verification. The capital “P” or “T” affixed in the number of any notice denotes “*preliminary*” or “*temporary*”, respectively.

A list of Temporary and Preliminary Notices that are still in force is published in this publication every month. The list may be read on Page v.

Section IV. List of Lights Corrections – Contains the corrections to the latest edition of the Philippine List of Lights. The entire entry for each light will be printed and the columns that contain updates will be denoted by an asterisk “*”. All columns will be denoted by asterisks in the case of new lights.

This section is intended to be printed, cut out, and pasted on the section of the List of Lights that is being corrected.

All updates to lighted aids, including their operational status, will be published in this section. All directions and bearings are measured clockwise from True North 000° to 360°. Bearing on lights is based on the observer from seaward toward the light. The visibility assigned to the lights never exceeds the calculated distance at which they can be seen from a height of 4.57 meters above the level of the water at high tide.

Changes in aids to navigation, their maintenance, and correction of deficiencies in operation are under the operation of the Philippine Coast Guard. Report of defects and recommendations concerning aids to navigation should also be forwarded to the Commandant of the Philippine Coast Guard.

Section V. Coast Pilot Corrections – Contains the corrections to the latest editions of the Philippine Coast Pilot books.

Section VI. Navigational Warnings – Contains the reprints of all previously issued navigational warnings that are still in effect as of the publication date of this edition of the Philippine Notices to Mariners.

Section VII. Publication Notices – Contains the latest updates on the nautical charts, electronic navigational charts, and other nautical publications of NAMRIA.

2. NAMRIA issues Notices to Mariners and Navigational Warnings sourced from private entities, foreign publications, national government agencies, and local government units. Such information is published for the sake of the safety of navigation on Philippine waters and does not imply recognition of the legal validity of the information issued by the abovementioned sources.
3. While every effort is made to ensure the accuracy of NAMRIA nautical charts and publications, users should bear in mind that it may not be complete or up-to-date, especially in areas where there are extensive developments. Mariners are advised to exercise prudence and to also refer to all navigational equipment aboard the ship and use a lookout during navigation.
4. Masters of vessels are warned that great care should be exercised in navigating Philippine waters because of the low visibility and occasional failure of some navigational lights. Buoys and beacons are sometimes lost or destroyed, especially after typhoons. Temporary deficiencies in the standard aids to navigation published in this office may have been corrected before subsequent notice is issued.
5. Positions obtained from satellite navigation systems, such as GPS, are normally referred to the WGS-84 Datum. Such position may only be plotted on NAMRIA nautical charts that are also referred to the WGS-84 Datum. Mariners should take note that due to the age and quality of some of the information, such satellite-derived positions may be more accurate than charted details.

List of Temporary and Preliminary Notices

(in force as of 31 May 2025)

04(011)P/25 Cebu, E. Coast, Cebu Harbor - Traffic separation scheme. Precautionary area.
03(009)T/25 LUZON, S. Coast, Alabat Island - Light
01(003)P/25 Cebu, E. Coast, Cebu Harbor - Dredged Area
01(002)T/25 LUZON, N. Coast, Port San Vicente – Light
01(001)T/25 DAVAO, NE. Coast, Pakiputan Strait – Buoys
11(115)T/24 BATANES GROUP OF ISLANDS, Batan Island – Light
10(110)T/24 LUZON, W. Coast, Manila Bay – Wreck. Restricted Area
10(109)T/24 LUZON, W. Coast, Manila Bay – Buoy
10(108)T/24 DAVAO, NE. Coast, Pakiputan Strait – Buoys
09(101)P/24 LUZON, W. Coast, Zambales – Dredging
09(100)P/24 LUZON, W. Coast, Manila Bay – Reclamation
08(092)T/24 WEST PHILIPPINE SEA, Julian Felipe Reef – Buoys
08(091)T/24 LUZON, S. Coast, Odiongan Bay – Buoy
08(090)T/24 LEYTE, S. Coast, San Juan – Lights
08(089)T/24 LEYTE, N. Coast, Biliran I – Light
08(088)T/24 SAMAR, W. Coast – Lights
08(087)T/24 SAMAR, NE. Coast, Hiuinatungan I – Light
08(086)T/24 KALAYAAN ISLAND GROUP, Pag-asa Island – Buoy
07(074)T/24 PALAWAN, N. COAST, Cabuli I. – Light
07(073)T/24 LUZON, S. COAST, Sibuyan I – Lights
07(072)T/24 LUZON, NE. COAST – Lights
07(071)T/24 PHILIPPINE RISE, Benham Bank – Buoys
07(070)T/24 PALAWAN, N. COAST, Coron Passage – Buoys
07(069)T/24 LUZON, S. COAST, Sibuyan Island – Lights
07(068)T/24 LUZON, S. COAST, Laguna de Bay – Lights
07(067)T/24 LUZON, N. COAST, Batan Island – Light
07(066)T/24 LUZON, W. COAST, Manila Bay – Anchorage
07(065)T/24 LUZON, NE. COAST, Padsan River – Dredging
09(114)P/23 LUZON. S. COAST, Batangas Bay – Terminal
03(048)T/23 PALAWAN, E. COAST, off Miniloc Island – Buoy
03(047)T/23 BOHOL, W. COAST, Dawahon Bank – Light
02(032)T/23 PALAWAN, N. COAST, Coron Bay – Buoy
02(031)T/23 LUZON, W. COAST, Manila Bay – Buoy
01(020)T/23 LUZON, W. COAST, Manila Bay - Buoy
12(077)T/22 MASBATE, NORTH COAST, Masbate Harbor – Beacon
09(040)T/22 LUZON, W. COAST, Manila Bay – Buoy
07(032)T/22 LUZON, W. COAST, Manila Bay – Buoy
07(031)T/22 LUZON, W. COAST, Manila Bay – Buoy
05(022)T/22 LUZON, W. COAST, Manila Bay – Buoy
02(006)T/22 LUZON, W. COAST, Manila Bay – Buoys
04(023)P/19 MINDANAO, N. COAST, Iligan Bay – Buoy
02(014)P/17 MINDANAO, N. COAST, Butuan Bay – Submarine Pipeline

TABLE OF CONTENTS

Index of Charts Affected - - - - -	01
Chart Corrections - - - - -	02
Temporary & Preliminary Notices - - - - -	09
List of Lights Corrections - - - - -	10
Coast Pilot Corrections - - - - -	12
Navigational Warnings - - - - -	13
Publication Notices - - - - -	18

I

INDEX OF CHARTS AFFECTED

Chart No	Notice No.	Chart No	Notice No.	Chart No	Notice No.
1501	05(012)25	4708	05(013)25	PH2BJM40	05(012)25
1502	05(012)25 05(014)25 05(017)25	4714	05(012)25	PH2CVZ40	05(012)25 05(013)25 05(015)25 05(016)25
1538	05(013)25	4719	05(013)25 05(015)25		
1564	05(012)25 05(016)25	4723A	05(012)25 05(014)25 05(017)25	PH2NLZ40	05(012)25 05(014)25 05(017)25
4250	05(012)25	4723B	05(012)25		
4255	05(012)25	4726A	05(012)25 05(014)25 05(017)25		
4257	05(012)25				
4266	05(017)25	5003	05(013)25		
4705	05(012)25 05(014)25 05(017)25	5006	05(013)25		
4706	05(012)25 05(013)25 05(014)25 05(017)25	5008	05(012)25 05(014)25 05(017)25		
		5013	05(012)25		

II

CHART CORRECTIONS

*05(012)25 – LUZON, W. Coast, Luzon Sea - Submarine Cable

Chart 1501 2Ed 05/12/2021 [WGS-84 DATUM] Last NM 08(080)24

Insert



joining

14°04.22'N 120°37.52'E
 14°04.46'N 120°36.16'E
 14°04.97'N 120°35.24'E
 14°05.11'N 120°34.07'E
 14°07.99'N 120°26.89'E
 14°08.73'N 120°24.58'E
 14°09.59'N 120°20.70'E
 14°10.53'N 120°17.70'E
 14°11.60'N 120°16.28'E
 14°12.32'N 120°14.75'E
 14°12.49'N 120°13.67'E
 14°13.71'N 120°10.65'E
 14°13.72'N 120°09.22'E
 14°13.20'N 120°07.75'E
 14°13.16'N 120°06.07'E
 14°13.80'N 120°04.06'E
 14°14.79'N 120°02.52'E
 14°15.64'N 120°00.52'E
 14°15.89'N 119°58.69'E
 14°17.69'N 119°55.98'E
 14°22.00'N 119°52.59'E
 14°23.95'N 119°50.02'E
 14°26.28'N 119°45.46'E
 14°31.07'N 119°40.71'E
 14°46.13'N 119°33.67'E
 14°48.25'N 119°31.53'E
 14°55.22'N 119°18.01'E

Chart 1502 2Ed 09/28/2021 [WGS-84 DATUM] Last NM 04(031)24

Insert



joining

14°37.00'N 119°37.94'E
 14°46.13'N 119°33.67'E
 14°48.25'N 119°31.53'E
 14°53.38'N 119°20.34'E
 14°55.22'N 119°18.01'E

Chart 1564 2Ed 02/02/2012 Rev 11/29/2021 [WGS-84 DATUM] Last NM 03(006)25

Insert



joining

14°04.22'N 120°37.52'E
 14°04.46'N 120°36.16'E
 14°04.97'N 120°35.24'E
 14°05.11'N 120°34.07'E
 14°06.49'N 120°30.59'E

Chart 4250 1Ed 10/29/2021 [WGS-84 DATUM] Last NM 12(121)24

Insert



joining

14°07.65'N 120°27.79'E
 14°07.83'N 120°27.37'E

Chart 4255 2Ed 01/1975 Rev 06/1985 [Luzon Datum] Last NM 12(121)24

Insert



joining

14°04.31'N 120°37.44'E
 14°04.54'N 120°36.07'E
 14°05.05'N 120°35.16'E
 14°05.19'N 120°33.98'E
 14°08.82'N 120°24.50'E
 14°09.68'N 120°20.62'E
 14°10.39'N 120°19.09'E

II

CHART CORRECTIONS

***05(012)25 – LUZON, W. Coast, Luzon Sea - Submarine Cable**

(continued)

14°10.41'N 120°18.33'E
 14°10.61'N 120°17.62'E
 14°11.69'N 120°16.20'E
 14°12.41'N 120°14.67'E
 14°12.58'N 120°13.59'E
 14°13.80'N 120°10.56'E
 14°13.80'N 120°09.14'E
 14°13.29'N 120°07.67'E
 14°13.25'N 120°05.99'E
 14°13.89'N 120°03.97'E
 14°15.72'N 120°00.44'E
 14°16.72'N 119°57.45'E

Chart 4257 1Ed 01/9/1956 Rev 01/12/1981 [Luzon Datum] Last NM 03(037)23

Insert  joining

14°04'18.41"N 120°37'26.12"E
 14°04'18.32"N 120°37'21.35"E
 14°04'19.77"N 120°37'16.99"E
 14°04'32.63"N 120°36'04.48"E
 14°05'03.25"N 120°35'09.42"E
 14°05'06.59"N 120°34'23.62"E
 14°05'11.64"N 120°33'58.93"E
 14°05'54.67"N 120°32'17.08"E

Chart 4705 3Ed 03/2010 [WGS-84 DATUM] Last NM 12(121)24

Insert  joining

14°22.0'N 119°52.6'E
 14°31.1'N 119°40.7'E
 14°46.1'N 119°33.7'E
 15°08.5'N 119°06.0'E
 15°10.4'N 119°08.0'E
 15°10.5'N 119°04.3'E
 15°40.3'N 118°40.5'E
 15°42.8'N 118°38.1'E

Chart 4706 2Ed 12/2010 [WGS-84 DATUM] Last NM 12(121)24

Insert  joining

14°04.2'N 120°37.5'E
 14°05.0'N 120°35.2'E
 14°10.1'N 120°19.8'E
 14°13.7'N 120°10.6'E
 14°13.2'N 120°06.1'E
 14°15.9'N 119°58.7'E
 14°22.0'N 119°52.6'E
 14°31.1'N 119°40.7'E
 14°46.1'N 119°33.7'E
 15°00.1'N 119°11.9'E

Chart 4714 1Ed 09/1959 Rev 03/1986 [Luzon Datum] Last NM 03(006)25

Insert  joining

14°04.31'N 120°37.44'E
 14°05.05'N 120°35.16'E
 14°10.22'N 120°19.70'E
 14°13.80'N 120°10.56'E
 14°13.25'N 120°05.99'E
 14°15.98'N 119°58.61'E
 14°22.09'N 119°52.51'E
 14°31.15'N 119°40.63'E
 14°35.93'N 119°38.36'E

II

CHART CORRECTIONS

*05(012)25 – LUZON, W. Coast, Luzon Sea - Submarine Cable

(continued)

Chart 4723A 2Ed 12/22/2018 [WGS-84 DATUM] Last NM 10(103)24

Insert  joining

14°04.2'N 120°37.5'E
14°13.7'N 120°10.6'E
14°13.2'N 120°06.1'E
14°15.9'N 119°58.7'E
14°48.2'N 119°31.5'E
15°08.5'N 119°06.0'E
15°10.4'N 119°08.0'E
15°10.5'N 119°04.3'E

15°15.7'N 119°01.5'E

Chart 4723B 2Ed 20/04/2023 [WGS-84 DATUM] Last NM 11(114)24

Insert  joining

14°04.2'N 120°37.5'E
14°13.7'N 120°10.6'E
14°13.2'N 120°06.1'E
14°15.9'N 119°58.7'E
14°22.0'N 119°52.6'E
14°31.1'N 119°40.7'E
14°37.0'N 119°37.9'E

Chart 4726A 5Ed 02/26/2025 [WGS-84 DATUM] Last NM. 11(111)24

Insert  joining

14°04.2'N 120°37.5'E
14°13.7'N 120°10.6'E
14°13.2'N 120°06.1'E
14°15.3'N 120°01.4'E

Chart 5008 1Ed 02/15/2024 [WGS-84 DATUM] Last NM 11(114)24

Insert  joining

14°04.2'N 120°37.5'E
14°05.0'N 120°35.2'E
14°10.1'N 120°19.8'E
14°13.7'N 120°10.6'E
14°13.2'N 120°06.1'E
14°15.9'N 119°58.7'E
14°22.0'N 119°52.6'E
14°26.3'N 119°45.5'E
14°46.1'N 119°33.7'E
14°53.4'N 119°20.3'E
15°00.1'N 119°11.9'E

Chart 5013 1Ed Rev 28/11/2022 [WGS-84 DATUM] Last NM 05(041)24

Insert  joining

14°15.7'N 120°00.0'E
14°15.9'N 119°58.7'E
14°22.0'N 119°52.6'E
14°26.3'N 119°45.5'E
14°46.1'N 119°33.7'E
14°53.4'N 119°20.3'E
15°08.5'N 119°06.0'E
15°10.4'N 119°08.0'E
15°10.5'N 119°04.3'E
16°02.1'N 118°18.6'E

II

CHART CORRECTIONS

*05(012)25 – LUZON, W. Coast, Luzon Sea - Submarine Cable

(continued)

ENCs Affected: PH2BJM40, PH2CVZ40, PH2NLZ40

(Optic Marine Installation Services Corp.)

*05(013)25 – LEYTE, SW. Coast, Cuatro Islas - Marine Protected Area. Legend

Chart 1538 1Ed 02/02/2012 [WGS84 Datum] Last NM 02(005)25

Insert		joining	10°29.7'N 124°42.9'E
	<i>Cuatro Islas Protected Landscape and Seascape</i>		10°27.3'N 124°39.4'E
			10°32.8'N 124°35.1'E
			10°35.4'N 124°41.0'E

Chart 4706 2Ed 12/2010 [WGS84 Datum] Last NM 05(013)25

Insert		joining	10°29.7'N 124°42.9'E
	<i>Cuatro Islas Protected Landscape and Seascape</i>		10°27.3'N 124°39.4'E
			10°32.8'N 124°35.1'E
			10°35.4'N 124°41.0'E

Chart 4708 2Ed 11/2010 [WGS84 Datum] Last NM 03(007)25

Insert		joining	10°29.7'N 124°42.9'E
	<i>Cuatro Islas Protected Landscape and Seascape</i>		10°27.3'N 124°39.4'E
			10°32.8'N 124°35.1'E
			10°35.4'N 124°41.0'E

Chart 4719 1Ed 06/30/2022 [Luzon Datum] Last NM 12(117)24

Insert		joining	10°29.8'N 124°42.8'E
	<i>Cuatro Islas Protected Landscape and Seascape</i>		10°27.4'N 124°39.3'E
			10°32.9'N 124°35.0'E
			10°35.5'N 124°40.9'E

Chart 5003 1Ed 02/13/2024 [WGS84 Datum] Last NM 12(120)24

Replace	<i>Cuatro Island Protected Area</i>	with	<i>Cuatro Islas Protected Landscape and Seascape</i>	at	10°32.1'N 124°28.0'E
---------	-------------------------------------	------	--	----	----------------------

Chart 5006 1Ed 02/27/2024 [WGS84 Datum]

Replace	<i>Cuatro Island Protected Area</i>	with	<i>Cuatro Islas Protected Landscape and Seascape</i>	at	10°32.1'N 124°28.0'E
---------	-------------------------------------	------	--	----	----------------------

ENC Affected: PH2CVZ40

(Malacañang)

*05(014)25 – LUZON, W. Coast, Capones Island – Wreck

Chart 1502 3Ed 09/11/2024 [WGS-84 DATUM] Last NM 05(012)25

Insert		at	14°57.45'N 119°50.55'E
--------	---	----	------------------------

Chart 4705 3Ed 03/2010 [WGS-84 DATUM] Last NM 05(012)25

Insert		at	14°57.5'N 119°50.6'E
--------	---	----	----------------------

II

CHART CORRECTIONS

*05(014)25 – LUZON, W. Coast, Capones Island – Wreck

(continued)

Chart 4706 2Ed 12/2010 [WGS-84 DATUM] Last NM 05(013)25

Insert		at	14°57.5'N 119°50.6'E
--------	---	----	----------------------

Chart 4723A 2Ed 12/22/2018 [WGS-84 DATUM] Last NM 05(012)25

Insert		at	14°57.5'N 119°50.6'E
--------	---	----	----------------------

Chart 4726A 5Ed 02/26/2025 [WGS-84 DATUM] Last NM 05(012)25

Insert		at	14°57.5'N 119°50.6'E
--------	---	----	----------------------

Chart 5008 1Ed 02/15/2024 [WGS-84 DATUM] Last NM 05(012)25

Insert		at	14°57.5'N 119°50.6'E
--------	---	----	----------------------

ENC's Affected: PH2NLZ40

(Philippine Coast Guard)

*05(015)25 – BOHOL, N. Coast, Dawahon Bank – Geographic Name

Chart 4719 1Ed 07/24/1961 Rev 02/12/1985 [Luzon Datum] Last NM 05(015)25

Amend Geographic name, Bilanbilangan Island to Bilangbilangan Island

at 10°14.59'N 124°27.50'E

ENC's Affected: PH2CVZ40

(Philippine Statistics Authority)

*05(016)25 – MINDORO, W. Coast, Pola Bay – Geographic Name

Chart 1564 2Ed 02/02/2012 Revised 11/29/2021 Last NM 05(012)25

Amend Geographic name, Taguihan Cove to Tiguihan Cove

at 13°09.73'N 121°26.10'E

ENC's Affected: PH2CVZ40

(Philippine Statistics Authority)

*05(017)25 – LUZON, W Coast, Subic Bay – Light. Tower. Wreck

Chart 1502 3Ed 11/09/2024 [WGS84 Datum] Last NM 05(014)25

Move	 Fl(2)10s27m12M	from	15°25.82'N 119°53.95'E
		to	15°25.76'N 119°54.14'E

	 Fl(3)15s	from	15°14.00'N 120°00.68'E
		to	15°14.03'N 120°00.72'E

Amend characteristics of Capones light from Fl(3)15s74m22M to Fl(3)7s74m22M

at 14°54.93'N 120°00.54'E

Insert		at	15°32.13'N 119°56.80'E
--------	---	----	------------------------

		at	15°34.32'N 119°56.09'E
--	---	----	------------------------

II CHART CORRECTIONS

***05(017)25 – LUZON, W Coast, Subic Bay – Light. Tower. Wreck**

(continued)

Chart 4266 1Ed 16/09/1968 Rev 03/06/1985 [LUZON] Last NM 04(031)24

Delete	 Fl(2)10s	at	15°25'54.00"N 119°53'52.00"E
Insert	 Fl(2)10s27m12M	at	15°25'51.25"N 119°54'03.28"E
	 Fl.G.5s "MPPCL-1"	at	15°32'55.24"N 119°54'06.06"E
	 Fl.G.5s "MPPCL-3"	at	15°32'15.74"N 119°54'24.46"E
	 Fl.G.5s "MPPCL-5"	at	15°32'07.54"N 119°54'38.96"E
	 Fl.G.5s "MPPCL-7"	at	15°32'28.34"N 119°55'35.16"E
	 Fl.G.5s "MPPCL-13"	at	15°33'05.14"N 119°55'51.86"E
	 Fl.R.5s "MPPCL-2"	at	15°32'24.84"N 119°53'42.76"E
	 Fl.R.5s "MPPCL-4"	at	15°32'19.64"N 119°53'57.86"E
	 Fl.R.5s "MPPCL-6"	at	15°31'54.84"N 119°54'24.46"E
	 Fl.R.5s "MPPCL-8"	at	15°32'40.24"N 119°56'17.06"E
	 Fl.R.5s "MPPCL-10"	at	15°33'05.54"N 119°56'05.16"E
	 Fl.R.5s "MPPCL-12"	at	15°33'35.84"N 119°55'35.66"E
	 Fl.Y.5s "MPPCL-14"	at	15°33'38.04"N 119°55'29.66"E
	 Fl.Y.5s "MPPCL-15"	at	15°33'33.24"N 119°55'26.86"E

II

CHART CORRECTIONS

***05(017)25 – LUZON, W Coast, Subic Bay – Light. Tower. Wreck**

(continued)

	Fl. Y. 5s "MPPCL-16"	at	15°33'34.24"N 119°55'26.16"E
	Fl. Y. 5s "MPPCL-19"	at	15°33'40.14"N 119°54'57.86"E
	VQ(3)5s "MPPCL-9"	at	15°32'47.44"N 119°55'42.86"E
		at	15°33'39.14"N 119°54'46.96"E 15°33'39.34"N 119°54'49.16"E 15°33'38.14"N 119°55'28.96"E
		at	15°34'25.07"N 119°56'00.61"E 15°34'23.27"N 119°56'03.31"E
		at	15°32'13.55"N 119°56'42.76"E
		joining	15°29'40.68"N 119°54'10.78"E 15°29'49.35"N 119°53'49.94"E
		joining	15°29'19.13"N 119°56'51.45"E 15°29'18.68"N 119°56'43.94"E 15°29'18.31"N 119°56'24.72"E

Chart 4705 3Ed 03/2010 [WGS84 Datum] Last NM 05(014)25

Amend characteristics of Capones light from Fl(3)15s74m22M to Fl(3)7s74m22M

at 14°54.9'N 120°00.5'E

Chart 4706 2Ed 12/2010 [WGS84 Datum] Last NM 05(014)25

Amend characteristics of Capones light from Fl(3)15s74m22M to Fl(3)7s74m22M

at 14°54.9'N 120°00.5'E

Chart 4723A 2Ed 22/12/2018 [WGS84 Datum] Last NM 05(014)25

Amend characteristics of Capones light from Fl(3)15s74m22M to Fl(3)7s74m22M

at 14°54.9'N 120°00.5'E

Chart 4726A 5Ed 26/02/2025 [WGS84 Datum] Last NM 05(014)25

Amend characteristics of Capones light from Fl(3)22M to Fl(3)7s74m22M

at 14°54.9'N 120°00.5'E

Chart 5008 1Ed 15/02/2024 [WGS84 Datum] Last NM 05(014)25

Amend characteristics of Capones light from Fl(3)15s74m22M to Fl(3)7s74m22M

at 14°54.9'N 120°00.5'E

ENC's Affected: PH2NLZ40

National Mapping and Resource Information Authority

III

TEMPORARY AND PRELIMINARY NOTICES

No Temporary and Preliminary Notices for this month.

IV

LIST OF LIGHTS CORRECTIONS

LIGHTHOUSES

	NUMBER (1)	NAME (2)	POSITION (3)	CHARACTERISTICS (4)	Elev(m) (5)	Range (NM) (6)	STRUCTURE (7)	REMARKS (8)
0035	F2682	PALAUIG	15 25 45.31 N 119 54 08.32 E	FI(2)10s	27	12	White metal framework tower, 9	Vis 330°- 180°(210°) TE 2024
0037	F2677	BOTOLAN	* 15 14 02.02 N 120 00 43.17 E	FI(3)15s			GRP	* TE 2024
0038	F2680	CAPONES	* 14 54 55.97 N 120 00 32.51 E	FI(3)7s	74	22	White concrete tower, 17	fl 0.21.
0469	F2684	HERMANA MAYOR	* 15 47 31.90 N 119 47 47.47 E	FI(3)5s	48	20	White concrete tower and dwelling, 9	* Vis 340°- 165°(185°)
			*					

LIGHTED BUOYS

NUMBER (1)	NAME (2)	POSITION (3)	CHARACTERISTICS (4)	Elev(m) (5)	Range (NM) (6)	STRUCTURE (7)	REMARKS (8)
	<i>MPPCL-1</i>	15°32'49.3"N 119°54'11.1"E	Fl.G.5s			PORT G, Topmark: Single green cylinder	Private
	<i>MPPCL-2</i>	* 15°32'18.9"N 119°53'47.8"E	Fl.R.5s			STARBOARD R, Topmark: Single red cone pointing upward	Private
	<i>MPPCL-3</i>	* 15°32'09.8"N 119°54'29.5"E	Fl.G.5s			PORT G, Topmark: Single green cylinder	Private
	<i>MPPCL-4</i>	* 15°32'13.7"N 119°54'02.9"E	Fl.R.5s			STARBOARD R, Topmark: Single red cone pointing upward	Private
	<i>MPPCL-5</i>	* 15°32'01.6"N 119°54'44.0"E	Fl.G.5s			PORT G, Topmark: Single green cylinder	Private
	<i>MPPCL-6</i>	* 15°31'48.9"N 119°54'29.5"E	Fl.R.5s			STARBOARD R, Topmark: Single red cone pointing upward	Private
	<i>MPPCL-7</i>	* 15°32'22.4"N 119°55'40.2"E	Fl.G.5s			PORT G, Topmark: Single green cylinder	Private
	<i>MPPCL-8</i>	* 15°32'34.3"N 119°56'22.1"E	Fl.R.5s			STARBOARD R, Topmark: Single red cone pointing upward	Private
	<i>MPPCL-9</i>	* 15°32'41.5"N 119°55'47.9"E	VQ(3)5s			E. CARDINAL BYB, Topmark: top cone	Private

IV

LIST OF LIGHTS CORRECTIONS

				pointing upward and bottom cone pointing downward.	
	*				
MPPCL-10	15°32'59.6"N 119°56'10.2"E	Fl.R.5s		STARBOARD R, Topmark: Single red cone pointing upward	Private
	*				
MPPCL-11	15 32 58 N 119 55 52 E	Fl.G.5s	Delete from the List of Light		
	*				
MPPCL-12	15°33'29.9"N 119°55'40.7"E	Fl.R.5s		STARBOARD R, Topmark: Single red cone pointing upward	Private
	*				
MPPCL-13	15°32'59.2"N 119°55'56.9"E	Fl.G.5s		PORT G, Topmark: Single green cylinder	Private
	*				
MPPCL-14	15°33'32.1"N 119°55'34.7"E	Fl.Y.5s		SPECIAL MARK Y, Topmark: Single yellow X	Private
	*				
MPPCL-15	15°33'27.3"N 119°55'31.9"E	Fl.Y.5s		SPECIAL MARK Y, Topmark: Single yellow X	Private
	*				
MPPCL-16	15°33'28.3"N 119°55'31.2"E	Fl.Y.5s		SPECIAL MARK Y, Topmark: Single yellow X	Private
	*				
MPPCL-17	15 33 35 N 119 55 10 E		Delete from the list of light		
	*				
MPPCL-18	15 33 16 N 119 55 24 E		Delete from the list of light		
	*				
MPPCL-19	15°33'34.2"N 119°55'02.9"E	Fl.Y.5s		SPECIAL MARK Y, Topmark: Single yellow X	Private
	*				
Unnamed buoy – 1	15°33'33.2"N 119°54'52.0"E			SPECIAL MARK Y,	Private
	*				
Unnamed buoy – 2	15°33'33.4"N 119°54'54.2"E			SPECIAL MARK Y, Topmark: Single Yellow X	Private
	*				
Unnamed buoy – 3	15°33'32.2"N 119°55'34.0"E			SPECIAL MARK Y, Topmark: Single Yellow X	Private
	*				
	*				

Note: Asterisk (*) indicates new information in the column above it. Positions given are approximate and in WGS84 Datum unless otherwise stated in column 8.

V

COAST PILOT CORRECTIONS

Philippine Coast Pilot, 8th Ed. Volume I-A

Chapter 5 – LUZON ISLAND

Page 5-28, right column, line 25.

Replace:

Light (15°25'45.31"N., 119°54'08.32"E.) is displayed from

Page 5-29, left column, line 37-38.

Replace:

Major Light – Botolan Light (15°14'02.02"N., 120°00'43.17"E.) is displayed from a tower on the point.

Page 5-29, right column, line 30-31.

Replace:

near the light. Capones Light (14°54'55.97"N., 120°00'27"E.) is displayed from a white tower

VI

NAVIGATIONAL WARNINGS

*See all active Navigational Warnings at
<https://staging.geoportal.gov.ph/nwapp/>*

NAVPIL 204/24
WEST PHILIPPINE SEA.
KALAYAAN ISLAND GROUP.
CHART 4723A.
LIKAS ISLAND LIGHT 11-04.78N 115-01.33E,
F2823.8, UNLIT.

NAVPIL 272/24
SAMAR SEA.
CALBAYOG CITY.
CHART 1539.
LIGHTBUOYS 12-02.58N 124-35.45E AND 12-
03.35N 124-35.75E UNLIT.

NAVPIL 293/24
BUTUAN BAY.
LA UNION PT, SW.
CHART 1536.
SUBMERGED MOORING BUOY REPORTED
09-04.29N 125-31.05E.

NAVPIL 299/24.
LUZON SEA AND MANILA BAY.
CHART 1501 AND 1502.
DREDGING AND RECLAMATION ACTIVITIES
BY MV AN DA KANG 689, 5,445.00
TONS, IN PROGRESS UNTIL 30 JUNE 2025 IN
AREAS BOUNDED BY:
A. DREDGING AREA
15-02.55N 120-02.71E
15-02.56N 120-03.35E
15-01.76N 120-03.38E
15-01.76N 120-02.73E,
B. RECLAMATION AREA
14-33.23N 120-57.10E
14-33.28N 120-57.10E
14-33.24N 120-57.66E
14-33.23N 120-57.66E.
CANCEL THIS MSG 01 JULY 25.

NAVPIL 305/24
CALAMIAN GROUP.
CORON PASSAGE.
CHART 1553.
PORT HAND LIGHTBUOY 11-59.30N 120-
14.73E MISSING.

NAVPIL 307/24
MANILA BAY.
MANILA SOUTH HARBOR.
CHART 4243.
LIGHTBUOY, NNSL 8, 14-34.26N 120-54.64E
OFF STATION TO 14-34.28N
120-54.62E.

NAVPIL 351/24.
LUZON SEA.
PINGET I, W.
CHART 1504.
PINGET LIGHT, 17-41.33N 120-21.25E, F2715,
UNLIT.

NAVPIL 361/24
VERDE ISLAND PASSAGE.
CAPE SANTIAGO.
CHART 1564.
CAPE SANTIAGO LIGHT, 13-46.32N 120-
39.18E, F2614, UNLIT.

NAVPIL 362/24
PHILIPPINE SEA.
MINDANAO, E.
CHART 2200.
SUBMARINE CABLE REPAIRING WORKS BY
C/S ILE DE BREHAT, IN PROGRESS
UNTIL FURTHER NOTICE, IN VICINITY OF
LINE JOINING:
08-21.00N 130-02.00E
08-33.00N 130-12.00E
08-45.00N 130-25.00E.

NAVPIL 363/24
PALAWAN, E.
GREEN ISLAND BAY.
CHART 1562.
BARBACAN LIGHT, 10-19.10N 119-21.01E,
F2169.5, UNLIT.

NAVPIL 386/24
MACAJALAR BAY.
MACABALAN PORT.
CHART 4646.
MACABALAN LIGHT, 08-30.42N 124-39.70E,
F2266, UNLIT.

NAVPIL 002/25
CEBU HARBOUR.
CHART 4446.
WRECK REPORTED 10-18.85N 123 56.22E.

NAVPIL 015/25
PALAWAN.
IPOLETE BAY.
CHART 1557.
BROOKES POINT LIGHTBUOYS
ESTABLISHED.
A. PORT HAND 8-45.90N 117-49.30E.
B. STARBOARD HAND 8-45.78N 117-49.86E.
C. PORT HAND 8-46.19N 117-49.44E.
D. STARBOARD HAND 8-46.12N 117-49.77E.
E. SPECIAL 8-46.13N 117-49.64E.

VI

NAVIGATIONAL WARNINGS

NAVPHIL 016/25

PALAWAN.

CORON BAY.

CHART 1553.

CULION LIGHTBUOYS ESTABLISHED.

- A. PORT HAND 11-53.50N 120-2.23E.
- B. STARBOARD HAND 11-54.13N 120-2.19E.
- C. PORT HAND 11-53.72N 120-1.41E.
- D. STARBOARD HAND 11-54.02N 120-1.35E.
- E. SOUTH CARDINAL 11-54.75N 120-4.28E.
- F. SOUTH CARDINAL 11-54.29N 120-3.52E.
- G. ISOLATED DANGER 11-53.72N 120-3.60E.

NAVPHIL 017/25

PALAWAN.

BACUIT BAY.

CHART 4341.

EL NIDO LIGHTBUOYS ESTABLISHED.

- A. PORT HAND 11-11.20N 119-23.10E.
- B. STARBOARD HAND 11-11.20N 119-23.04E.
- C. PORT HAND 11-11.09N 119-23.21E.
- D. STARBOARD HAND 11-11.06N 119-23.18E.
- E. ISOLATED DANGER 11-11.21N 119-21.45E.
- F. SOUTH CARDINAL 11-11.82N 119-21.78E.
- G. NORTH CARDINAL 11-11.14N 119-22.51E.
- H. NORTH CARDINAL 11-11.30N 119-22.74E.
- I. SOUTH CARDINAL 11-11.87N 119-22.54E.
- J. EAST CARDINAL 11-12.53N 119-22.86E.
- K. EAST CARDINAL 11-11.90N 119-22.92E.
- L. NORTH CARDINAL 11-11.36N 119-22.90E.
- M. WEST CARDINAL 11-11.36N 119-23.08E.
- N. WEST CARDINAL 11-11.00N 119-23.25E.

NAVPHIL 018/25

PALAWAN.

PUERTO PRINCESA HARBOR.

CHART 1555.

PUERTO PRINCESA LIGHTBUOYS ESTABLISHED.

- A. PORT HAND 9-42.30N 118-45.68E.
- B. STARBOARD HAND 9-42.77N 118-45.75E.
- C. PORT HAND 9-42.64N 118-44.86E.
- D. STARBOARD HAND 9-43.08N 118-44.97E.
- E. PORT HAND 9-42.91N 118-44.20E.
- F. STARBOARD HAND 9-43.38N 118-44.26E.
- G. NORTH CARDINAL 9-44.37N 118-43.20E.
- H. NORTH CARDINAL 9-44.58N 118-43.26E.
- I. NORTH CARDINAL 9-44.79N 118-43.81E.

NAVPHIL 019/25

PALAWAN.

BARBACAN PT, S.

CHART 1555.

ROXAS LIGHTBUOYS ESTABLISHED.

- A. PORT HAND 10-13.60N 119-20.30E.
- B. STARBOARD HAND 10-13.74N 119-21.23E.
- C. PORT HAND 10-14.79N 119-20.23E.
- D. STARBOARD HAND 10-14.81N 119-21.12E.
- E. PORT HAND 10-16.40N 119-20.10E.

F. STARBOARD HAND 10-16.44N 119-20.92E.

G. WEST CARDINAL 10-13.20N 119-21.31E.

H. WEST CARDINAL 10-17.56N 119-20.80E.

I. WEST CARDINAL 10-18.33N 119-20.67E.

NAVPHIL 020/25

PALAWAN.

TAYTAY HARBOR.

CHART 1554.

TAYTAY LIGHTBUOYS ESTABLISHED.

- A. PORT HAND 10-48.23N 119-36.08E.
- B. STARBOARD HAND 10-48.34N 119-36.18E.
- C. PORT HAND 10-48.36N 119-35.71E.
- D. STARBOARD HAND 10-48.53N 119-35.79E.
- E. EAST CARDINAL 10-47.86N 119-36.49E.
- F. EAST CARDINAL 10-48.55N 119-35.56E.

NAVPHIL 022/25

SAN MIGUEL BAY.

CHART 1514.

1. HYDROGRAPHIC SURVEY IN PROGRESS UNTIL 31 JUL 2025 BY MB

ABSD, 10 TONS, IN AREA BOUND BY

14-02.12N 123-06.83E

14-02.45N 123-09.70E

14-01.58N 123-12.47E

13-58.08N 123-13.87E

13-55.62N 123-17.62E

13-49.00N 123-19.43E

13-43.67N 123-12.95E

13-46.45N 123-02.82E

13-52.45N 123-03.97E

13-59.02N 123-04.87E.

WIDE BERTH REQUESTED.

2. CANCEL THIS MSG 01 AUG 2025.

NAVPHIL 043/25

LUZON SEA.

CHART 1504.

1. DREDGING ACTIVITY IN PROGRESS UNTIL 31 DEC 2025 BY MV DE XIN 7 IN

THE AREA BOUND BY

17-30.47N 120-23.03E,

17-29.96N 120-22.16E,

17-28.66N 120-22.98E,

17-28.74N 120-23.10E,

17-28.19N 120-23.85E,

17-28.20N 120-24.72E,

17-29.17N 120-24.72E,

17-29.17N 120-23.84E.

2. CANCEL THIS MSG 01 JAN 2026.

NAVPHIL 044/25

LUZON SEA.

ABRA R.

CHART 1504.

1. DREDGING ACTIVITY IN PROGRESS UNTIL 31 DEC 2025 BY MV DE XIN 7 IN

THE AREA BOUND BY

VI

NAVIGATIONAL WARNINGS

17-30.19N 120-23.33E,
17-30.49N 120-23.19E,
17-33.61N 120-27.18E,
17-30.77N 120-25.00E.
2. CANCEL THIS MSG 01 JAN 2026.

NAVPIL 053/25
MINDORO I, W.
APO EAST PASS.
CHART 4726A

1.DREDGING OPERATIONS IN PROGRESS
UNTIL 04 DEC 2025 BY DEXIN 7,LIANG KU 9,
LIANG KU 99, HONG KU 588, HONG FU 598,
HENG DA 188,HENG DA 988, FENG SHOU 178,
TAI SHUN 88, HONG FU 518, LIANG KU88,
LIANG KU 89, JIN HAI FU 168, ZHONG XING
HANG 268, HONG FU558, HENG DA 17, HENG
DA 19, HONG FA 158, HONG FA 178, HUI
JINQIAO 139, XIANG HANG 555, HONG FA 567,
RUN TAI ZHI HANG, HENG DA99, HONG HAI
199, HONG HAI 16, AND YONG XIN 1 IN THE
AREA BOUNDBY
12-54.64N 120-44.36E, 12-57.20N 120-43.72E,
12-57.72N 120-46.16E, 12-56.64N 120-46.25E,
12-57.04N 120-46.88E, 12-56.98N 120-46.96E,
12-56.33N 120-46.34E, 12-55.23N 120-46.75E.
2.WIDE BERTH REQUESTED.
3.CANCEL THIS MSG 05 DEC 2025

NAVPIL 065/25
LAMON BAY.
PORT ALABAT.
CHART 1513.
ALABAT PORT LIGHT 14-05.93N 122-055E
TEMPORARILY REMOVED.

NAVPIL 067/25
CYNTHIA BAY.
MARIQUIT I, SW.
CHART 1554.
SALVAGE OPERATIONS IN PROGRESS UNTIL
FURTHER NOTICE IN VICINITY 10-32.40N 120-
00.03E.
WIDE BERTH REQUESTED.

NAVPIL 078/25
MANILA BAY.
CHART 1501.
1.SCIENTIFIC OPERATIONS IN PROGRESS
UNTIL 30 SEPT 2025 BY MTUG
SEASTRENGTH ONE AND BARGE
STONEWORKS 203 IN VICINITY LINES
JOINING:
14-33.08N 120-57.70E, 14-33.07N 120-57.72E,
14-33.05N 120-57.74E, 14-33.04N 120-57.76E,
14-33.02N 120-57.77E.
WIDE BERTH REQUESTED.
2.CANCEL THIS MSG 01 OCT 2025.

NAVPIL 079/25
MANILA BAY.
SANGLEY PT, NE.
CHART 1501.
1. DREDGING OPERATIONS IN PROGRESS
UNTIL 25 AUG 2025 BY HANGBU 3001 AND JIN
XIN 23 IN THE AREA BOUND BY
14-33.55N 120-58.64E, 14-31.62N 120-58.75E,
14-31.57N 120-57.58E, 14-31.69N 120-57.14E,
14-31.66N 120-54.20E, 14-32.04N 120-54.20E,
14-32.07N 120-57.14E, 14-33.01N 120-57.24E,
14-33.42N 120-58.17E.
WIDE BERTH REQUESTED.
2. CANCEL THIS MSG 26 AUG 2025.

NAVPIL 080/25
MANILA BAY.
CHART 1501.
1. DREDGING OPERATIONS IN PROGRESS
UNTIL 31 DEC 2025 BY MV SILK ROAD 13 IN
THE AREA BOUND BY
14-37.72N 120-56.77E, 14-37.75N 120-56.77E,
14-37.77N 120-57.40E, 14-37.76N 120-57.42E,
14-37.59N 120-57.57E, 14-37.57N 120-57.57E,
14-37.58N 120-57.55E, 14-37.71N 120-57.43E,
14-37.70N 120-57.43E, 14-37.73N 120-57.40E,
14-37.74N 120-57.39E.
WIDE BERTH REQUESTED.
2. CANCEL THIS MSG 01 JAN 2026.

NAVPIL 096/25
LAGONUY GULF.
MAQUEDA CHANNEL.
CHART 1514.
1.CABLE LAYING OPERATIONS FROM 30 APR
UNTIL 31 MAY 2025 BY CS FU HAIIN VICINITY
OF LINES JOINING
13-36.06N 124-05.32E, 13-35.06N 124-03.51E,
13-34.97N 123-59.37E, 13-35.54N 123-57.07E,
13-37.29N 123-54.89E, 13-40.68N 123-52.66E,
13-44.18N 123-52.10E.
WIDE BERTH REQUESTED.
2.CANCEL THIS MSG 01 JUN 2025.

NAVPIL 097/25
LUZON SEA TO BABUYAN CHANNEL.
LUZON I, N TO W.
CHART 4705.
1. CABLE LAYING OPERATIONS FROM 30 APR
UNTIL 31 MAY 2025 BY CS FU HAI IN VICINITY
OF LINES JOINING
A. 18-36.40N 121-04.03E, 18-39.29N 121-
05.49E,
18-40.70N 121-07.62E, 18-41.04N 121-10.65E,
18-40.64N 121-15.32E, 18-39.94N 121-18.10E,
18-37.75N 121-21.59E, 18-31.10N 121-28.80E,
18-28.80N 121-30.25E, 18-25.05N 121-30.59E.
B. 17-57.62N 120-28.48E, 17-59.05N 120-
26.65E,

VI

NAVIGATIONAL WARNINGS

18-06.55N 120-22.27E, 18-09.36N 120-21.47E,
18-10.94N 120-22.18E, 18-14.72N 120-21.96E,
18-24.41N 120-23.70E, 18-33.61N 120-28.55E,
18-38.14N 120-33.28E, 18-40.64N 120-39.49E,
18-42.30N 120-41.54E, 18-42.95N 120-43.20E,
18-42.79N 120-51.75E, 18-41.98N 120-55.23E,
18-42.23N 120-59.59E, 18-41.50N 121-01.37E,
18-39.23N 121-04.52E, 18-36.39N 121-04.03E.
C. 16-51.62N 120-22.70E, 16-53.48N 120-
20.70E,

16-55.59N 120-20.14E, 16-57.50N 120-20.19E,
16-59.50N 120-20.96E, 17-00.72N 120-20.95E,
17-05.61N 120-23.26E, 17-07.97N 120-23.37E,
17-13.90N 120-22.27E, 17-17.27N 120-22.84E,
17-21.37N 120-24.78E, 17-23.50N 120-24.06E,
17-26.15N 120-24.89E, 17-26.95N 120-24.20E,
17-27.82N 120-24.16E, 17-29.59N 120-22.55E,
17-30.70N 120-19.96E, 17-32.97N 120-17.45E,
17-35.98N 120-12.39E, 17-37.75N 120-11.35E,
17-40.52N 120-11.13E, 17-49.71N 120-13.69E,
17-54.44N 120-17.19E, 17-56.37N 120-20.64E,
17-57.62N 120-28.48E.

D. 15-53.07N 119-53.56E, 15-54.24N 119-
50.84E,

15-53.82N 119-47.73E, 15-55.00N 119-40.43E,
15-55.79N 119-38.72E, 15-57.35N 119-37.48E,
15-59.75N 119-36.14E, 16-02.36N 119-35.78E,
16-11.44N 119-36.82E, 16-20.10N 119-36.51E,
16-21.51N 119-37.19E, 16-22.53N 119-38.14E,
16-24.75N 119-38.99E, 16-26.79N 119-41.38E,
16-28.19N 119-43.95E, 16-30.61N 119-45.89E,
16-45.05N 120-03.04E, 16-47.52N 120-04.67E,
16-48.18N 120-05.56E, 16-48.45N 120-06.72E,
16-50.69N 120-10.27E, 16-51.27N 120-14.21E,
16-52.23N 120-16.83E, 16-52.30N 120-20.12E,
16-51.62N 120-22.70E.

E. 15-03.65N 120-03.64E, 15-04.03N 120-
01.61E,

15-07.24N 119-58.11E, 15-10.17N 119-57.12E,
15-12.36N 119-57.29E, 15-14.69N 119-58.67E,
15-16.24N 119-58.14E, 15-17.54N 119-56.11E,
15-18.78N 119-49.69E, 15-24.92N 119-43.56E,
15-30.01N 119-41.98E, 15-43.15N 119-40.38E,
15-46.46N 119-41.22E, 15-50.51N 119-45.64E,
15-52.51N 119-48.62E, 15-52.80N 119-49.85E,
15-52.35N 119-52.73E, 15-53.07N 119-53.56E.

WIDE BERTH REQUESTED.

2.CANCEL THIS MSG 01 JUN 2025.

NAVPIL 098/25 APO EAST PASS.

MANGARIN PT, NW.

CHART 1552.

1.SAR OPERATION IN PROGRESS UNTIL
FURTHER NOTICE AT THE VICINITY12 30.30N
120 55.43E.

2.ALL VESSELS NOT UNDER INSTRUCTION
OF THE SAR MISSION TO KEEP A WIDE
BERTH.

NAVPIL 104/25

PALAWAN PASSAGE.

TAPIUTAN I, NW.

CHART 1563.

1. SCIENTIFIC OPERATIONS BY NOBLE
VIKING FROM 15 MAY TO 14 OCT 2025 IN: A.
11-38.23N 118-56.36E B. 11-34.11N 118-53.54E
C. 11-48.76N 118-57.68E

2. CANCEL THIS MSG 15 OCT 2025.

NAVPIL 105/25

MANILA BAY.

LIMAY PT, E.

CHART 4250.

1. WRECK REMOVAL OPERATIONS IN
PROGRESS 14-30.32N 120-40.46E. A
TEMPORARY EXCLUSION ZONE RADIUS
THREE NAUTICAL MILES HAS BEEN
ESTABLISHED CENTERED ON THIS
POSITION.

2. SHIPS ARE PROHIBITED FROM ENTERING
OR REMAINING WITHIN THIS ZONE.

NAVPIL 107/25

MANILA BAY.

SANGLEY PT, NE.

CHART 1501.

1.DREDGING OPERATIONS IN PROGRESS
UNTIL 17 SEPT 2025 BY BKS 292, BKM 102,
BARGE AST1805 AND TUG SKUA IN AREA
BOUND BY14-31.80N 120-53.70E, 14-31.96N
120-53.67E,

14-32.90N 120-55.52E, 14-33.58N 120-55.51E,
14-33.57N 120-55.93E, 14-33.56N 120-56.94E,
14-33.55N 120-58.14E, 14-33.07N 120-58.14E,
14-32.80N 120-57.56E, 14-32.44N 120-56.79E,
14-32.14N 120-56.16E, 14-32.19N 120-55.85E,
14-32.33N 120-55.52E.

WIDE BERTH REQUESTED.

2.CANCEL THIS MSG 18 SEPT 2025.

Please

NAVPIL 113/25

MINDORO STRAIT.

PAGBAHAN R.

CHART 1564.

1. DREDGING OPERATIONS IN PROGRESS
UNTIL 24 JUL 2025 BY MV HENGDA 169, MV
HENGDA 179, AND HENG DA 7 IN AREA
BOUND BY

13-08.15N 120-41.03E, 13-08.08N 120-41.04E,
13-07.69N 120-40.78E, 13-07.91N 120-40.72E,
13-07.87N 120-40.62E, 13-07.93N 120-40.57E.
WIDE BERTH REQUESTED.

2. CANCEL THIS MSG 25 JUL 2025.

VI

NAVIGATIONAL WARNINGS

NAVPHIL 114/25
MANILA BAY.
SANGLEY PT, NE.
CHART 1501.

1. DREDGING OPERATIONS IN PROGRESS UNTIL 24 JUL 2025 BY MV HENGDA 169, MV HENGDA 179, AND HENG DA 7 IN AREA BOUND BY
14-33.55N 120-58.64E, 14-31.62N 120-58.75E, 14-31.57N 120-57.58E, 14-31.69N 120-57.14E, 14-32.07N 120-57.14E, 14-33.01N 120-57.24E, 14-33.42N 120-58.17E.
WIDE BERTH REQUESTED.
2. CANCEL THIS MSG 25 JUL 2025.

NAVPHIL 116/25
LINGAYEN GULF.
SAN FERNANDO HARBOR.
CHART 4246 AND 1503.

1. SCIENTIFIC OPERATIONS BY FB AURORA IN PROGRESS UNTIL 30 JUN 2025 ALONG A LINE JOINING
16-35.98N 120-18.05E, 16-35.97N 120-18.04E, 16-35.84N 120-17.71E, 16-35.72N 120-17.43E, 16-35.54N 120-17.00E, 16-35.52N 120-16.77E, 16-35.51N 120-16.60E.
2. CANCEL THIS MSG 01 JUL 2025.

NAVPHIL 117/25
SULU SEA.
PUERTO PRINCESA.
CHART 4333.

1. HYDROGRAPHIC SURVEY IN PROGRESS UNTIL 19 JUN 2025 BY BRP HYDROGRAPHER VENTURA IN AREA BOUND BY
09-45.32N 118-42.35E, 09-45.32N 118-47.27E, 09-42.22N 118-47.27E, 09-42.22N 118-42.35E.
2. CANCEL THIS MSG 20 JUN 2025.

NAVPHIL 126/25
LUZON SEA.
HORNOS PT, S.
CHART 1501.

1. NAVAL FIRING EXERCISES 26 MAY TO 01 JUN 2025 IN AREA BOUND BY
14-21.16N 120-29.28E, 14-16.96N 120-29.48E, 14-16.47N 120-22.31E, 14-20.65N 120-22.08E.
2. CANCEL THIS MSG 02 JUN 2025.

NAVPHIL 130/25
SIBUYAN SEA.
SALOMANGUE PT, SE.
CHART 1542.

1. NAVAL FIRING EXERCISES 31 MAY TO 06 JUN 2025 IN AREA BOUND BY 13-15.31N 122-14.45E, 13-16.33N 122-15.23E, 13-15.58N 122-16.47E, 13-14.67N 122-15.53E.
2. CANCEL THIS MSG 07 JUN 2025.

VII

PUBLICATION NOTICES

1. Newly published and updated Nautical Charts.
 - a. Chart 4726A – Talampas ng Pilipinas (Philippine Rise)
Scale 1:1 250 000, 5th Edition, 26 February 2025

NAMRIA BULLETIN

1. Mariners are requested to notify the Hydrography Branch, NAMRIA of any changes or discrepancies found on Nautical charts and Nautical publications issued by this office, especially if this affects navigational safety in Philippine Waters. The information may be sent using the Hydrographic Note found at <https://namria.gov.ph/omsis/HNote10.aspx>.
2. Clients may purchase maps, nautical charts, publications, and other maritime products online at <https://namria.gov.ph/eMapa>.
3. Please be advised that effective in October 2023, in alignment with Civil Service Commission Memorandum Circular numbers 22, series of 2014 and 6, series of 2022, and in support of the Department of Energy's energy-efficiency initiatives, we are implementing remote-work practice for non-frontline personnel every Friday. Frontline personnel engaged in critical functions and services will maintain their onsite presence.
4. Frontline personnel can be reached through the following contact numbers: Taguig City, Fort Bonifacio Map Sales Office (MSO) - (02) 8810-4831 to 42 at local 431, (02) 8810-5467, 0956 5587584, and 0915 2777903; San Nicolas, Manila MSO - (02) 8245-9498, (02) 8241-3494 at local 117, 0966 8523814, and 0921 3627524; DENR-Visayas Avenue (MSO) - 0999 6079193 and 0928 4497159; and Client Service Section - css.gismb@namria.gov.ph and 02 88875466.

Nautical Charts, Topographic Maps, Tide and Current Tables, and related publications are available for sale at the NAMRIA Map Sales Offices (MSO). Nautical Charts can also be purchased online thru <https://namria.gov.ph/eMapa/>

Region	Address	MSO STAFF	Phone/Fax
Main	Lawton Avenue, Fort Andres Bonifacio, Taguig City	Michelle Ann M. Aguilar Ana Victoria A. Labor Marlon Y. Aguilar	(02) 8810-4831 to 42 loc 431 (02) 8810-5467 0956 5587584 0915 2777903
NCR	421 Barraca Street, San Nicolas, Binondo, Manila	SN3 Marilou B. Cinco Romeo B. Brizuela Mary Jane M. Montano	(02) 8245-9498 (02) 8241-3494 loc 117 0966 8523814
NCR	FMB Building DENR Compound, Visayas Avenue, Quezon City	Sherry Ann S. Perez Glenn M. De Jesus	0999 6079193 0928 4497159
I	DENR Government Center, Sevilla City, San Fernando, La Union	Ayessa A. Valencia	0905 3443202
II	DENR-Land Evaluation Party Building II, Brgy. Carig, Tuguegarao City	Rubilyn T. Pulpulaan	0917 6519625
III	DENR Compound, Diosdado, Macapagal Gov't. Center. Maipis City, San Fernando, Pampanga	Rosalina M. Libunao	0991 3509756
IVA	Provincial Planning and Development Office, Capitol Complex, Batangas City	Engr. Leda P. Velasquez	0961 4552583
IVB	DENR-PENRO Santa Monica, Puerto Princesa City	Juvy B. Sarmiento Corazon L. Zeñarosa	0916 203 8041
V	DENR-Operation/Survey Division, Rizal Street, Sagpon, Legaspi City, Albay	Isabelita T. Climaco	0906 3363033
VI	Manuel Lagunilla Bldg., DENR Compound, Parola, Iloilo City	Temporarily Closed	
VII	DENR-CENRO Building, Arellano Boulevard corner V. Sotto Street Pier 3, Cebu City	Melchor Togonon Renato B. Alcontin, Jr.	0922 7910372 0931 0010341 0961 4552579
VIII	DENR Compound, Santo Niño Extension, Tacloban City	Temporarily Closed	
IX	Pres. Corazon C. Aquino Regional Government Center, Balintawak, Pagadian City, Zamboanga Del Sur	Ednalyn C. Macahidhid	0955 5826075 0948 2943647
IX	DENR CENRO, West General Vicente Alvarez St., Zone 4, Zamboanga City	Annete P. Flores	0955 8928777
X	DENR Building Macabalan, Cagayan de Oro City, Misamis Oriental	Temporarily Closed	
XI	Kilometer 7, SPED Road, Bangkal, Davao City	Temporarily Closed	
XII	3rd Floor, DENR Building Land Evaluation Survey Section, Aurora Street, Barangay Zone IV Koronadal City, South Cotabato	Jeanyluz B. Bautista	0909 9324745
CARAGA	DENR - Land Management Services Building, Ambago, Butuan City, Agusan del Norte	Maricar E. Siega	0948 3619452