



PHILIPPINE NOTICES TO MARINERS

**Edition No.: 08
31 August 2023**

Notices Nos.: 092 to 101

CONTENTS

- I Index of Charts Affected
 - II Notices to Mariners
 - III Corrections to Nautical Publications
 - IV Navigational Warnings
 - V Publication Notices
-

Prepared by the Maritime Affairs Division
Produced by the Hydrography Branch

Published by the
Department of Environment and Natural Resources
NATIONAL MAPPING AND RESOURCE INFORMATION AUTHORITY

Notices to Mariners – Philippine edition are now online at
<http://www.namria.gov.ph/download.php#publications>

Subscription may be requested thru e-mail at maritime.affairs@namria.gov.ph

THE PHILIPPINE NOTICES TO MARINERS is a monthly publication produced by the Hydrography Branch of the National Mapping and Resource Information Authority (NAMRIA). It contains the recent chart correction data, updates to nautical publications, and other information that is vital for the safety of navigation on Philippine waters.

Copies in digital format may be obtained by sending a request through the e-mail address: css.gismb@namria.gov.ph or by downloading at the NAMRIA website: www.namria.gov.ph/download.php.

Masters of vessels and other concerned are requested to advance any report of dangers to navigation and other information affecting Philippine Charts and Coast Pilots which may come to their attention to the ***Director, Hydrography Branch***. If such information warrants urgent attention for instance the non-existence of aids to navigation or failure of light beacons or similar structures or discovery of new shoals, all concerned are requested to contact NAMRIA directly through the following portals:

Mail: NAMRIA-Hydrography Branch,
421 Barraca St San Nicolas, 1010 Manila, Philippines
E-mail: maritime.affairs@namria.gov.ph
Fax: (+632) 8242-2090

The Hydrographic Note form on the back-cover page of this publication must be used in reporting information on dangers to navigation, lighted aids, and other features that should be included in the nautical charts.


Subscribe to the **Philippine Online Maritime Safety Information System (OMSIS)**, <http://namria.gov.ph/omsis/landing.aspx> to access the Nautical Chart Corrections Service (e-NCC), Cumulative List of Notices to Mariners, and online Hydrographic Notes (e-HNote).

Explanatory Notes

1. The Philippine Notices to Mariners is divided into the following sections:

Section I. Index of Charts Affected – Contains the list of all nautical charts which have been affected by Notices to Mariners and the Notice Numbers which have affected them.

Section II. Chart Corrections - Contains corrections to nautical charts in sequential numbers with the indication of the month and year of its issuance. The illustration below describes the elements that comprise a typical notice:

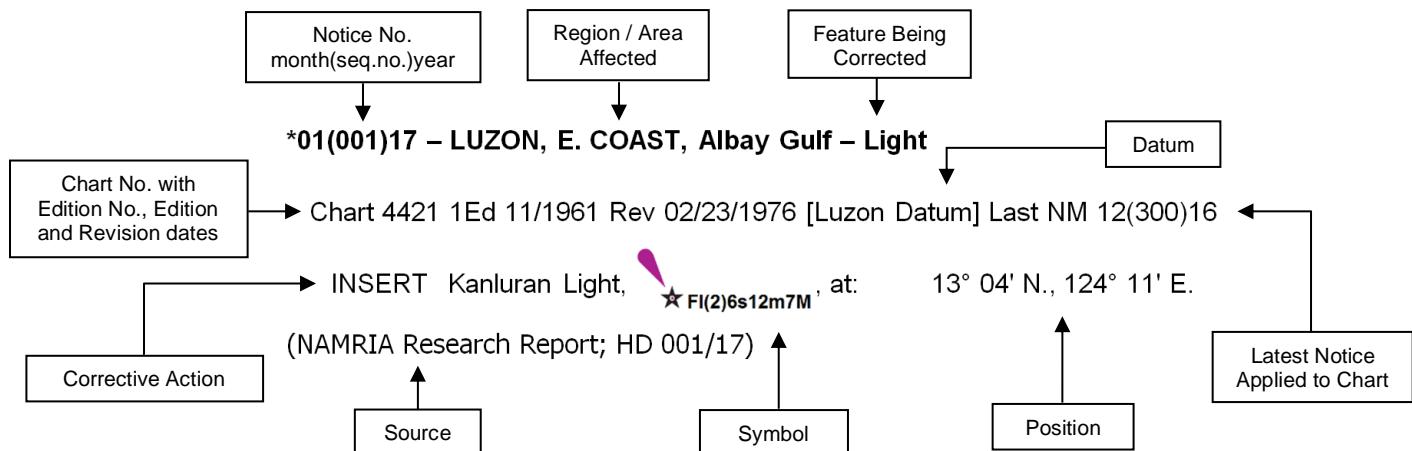

Notice No. preceded by an asterisk “ * ” indicates that the information is based upon the original Philippine source.

Section III. Temporary & Preliminary Notices – Contains Notices to Mariners that temporarily affect the nautical charts or have preliminary information that is subject to further verification. The capital “P” or “T” affixed in the number of any notice denotes “preliminary” or “temporary”, respectively.

A list of Temporary and Preliminary Notices that are still in force, as well as those that are canceled, is published in this publication every month. The list may be read on page iv.

Section IV. Corrections to List of Lights – Contains the corrections to the latest edition of the Philippine List of Lights. The entire entry for each light will be printed and the columns that contain updates will be denoted by an asterisk “ * ”. All columns will be denoted by asterisks in the case of new lights.

This section is intended to be cut out and pasted on the section of the List of Lights that is being corrected.

All updates to lighted aids, including their operational status, will be published in this section. All directions and bearings are measured clockwise from true the North 000° to 360°. Bearing on lights is based on the observer from seaward toward the light. The visibility assigned to the lights never exceeds the calculated distance at which they can be seen from a height of 4.57 meters above the level of the water at high tide. Changes in aids to navigation, their maintenance, and correction of deficiencies in operation are under the operation of the Philippine Coast Guard. Report of defects and recommendations concerning aids to navigation should be forwarded to the Commandant of the Philippine Coast Guard.

Section V. Coast Pilot Corrections – Contains the corrections to the latest edition of the Philippine Coast Pilot book.

Section VI. Navigational Warnings – Contains the reprints of all previously issued navigational warnings that are still in effect as of the publication date of this edition of the Philippine Notices to Mariners.

Section VII. Publication Notices – Contains the latest updates on the nautical charts, electronic navigational charts, and other nautical publications of NAMRIA.

2. NAMRIA issues Notices to Mariners and Navigational Warnings sourced from private entities, foreign publications, national government agencies, and local government units. Such information is published for the sake of the safety of navigation on Philippine waters and does not imply recognition of the legal validity of the information issued by the abovementioned sources.
3. While every effort is made to ensure the accuracy of NAMRIA nautical charts and publications, users should bear in mind that it may not be complete or up-to-date, especially in areas where there are extensive developments. Mariners are advised to exercise prudence and to also refer to all navigational equipment aboard the ship and use a lookout during navigation.
4. Masters of vessels are warned that great care should be exercised in navigating Philippine waters because of the low visibility and occasional failure of some navigational lights. Buoys and beacons are sometimes lost or destroyed, especially after typhoons. Temporary deficiencies in the standard aids to navigation published in this office may have been corrected before subsequent notice is issued.
5. Positions obtained from satellite navigation systems, such as GPS, are normally referred to the WGS-84 Datum. Such position may only be plotted on NAMRIA nautical charts that are also referred to the WGS-84 Datum. Mariners should take note that due to the age and quality of some of the information, such satellite-derived positions may be more accurate than charted details.

List of Temporary and Preliminary Notices

(in force as of 31 August 2023)

- 03(049)T/23 LUZON, W. Coast, Manila Bay - Buoy
- 03(048)T/23 PALAWAN, E. Coast, off Miniloc island - Buoy
- 03(047)T/23 BOHOL, W. COAST, Dawahon Bank – Light
- 02(032)T23 PALAWAN, N. Coast, Coron Bay – Buoy
- 02(031)T23 LUZON, W. Coast, Manila Bay – Buoy
- 01(019)T/23 LUZON, W. Coast, Manila Bay - Buoy
- 12(077)T22 MASBATE, NORTH COAST, Masbate Harbor - Beacon
- 09(040)T22 LUZON, W. COAST, Manila Bay – Buoy
- 07(032)T/22 LUZON, W. COAST, Manila Bay – Buoy
- 07(031)T/22 LUZON, W. COAST, Manila Bay – Buoy
- 05(022)T/22 LUZON, W. COAST, Manila Bay – Buoy
- 02(006)T/22 LUZON, W. COAST, Manila Bay – Buoys
- 04(023)P/19 MINDANAO,N. COAST, Iligan Bay – Buoy
- 02(014)P/17 MINDANAO,N. COAST, Butuan Bay – Submarine Pipeline

TABLE OF CONTENTS

Index of Charts Affected - - - - -	01
Chart Corrections - - - - -	02
Temporary & Preliminary Notices - - - - -	16
List of Lights Corrections - - - - -	17
Coast Pilot Corrections - - - - -	18
Navigational Warnings - - - - -	20
Publication Notices - - - - -	28
Hydrographic Notes - - - - -	29

INDEX OF CHARTS AFFECTED

Chart No	Notice No.	Chart No	Notice No.	Chart No	Notice No.	Chart No	Notice No.
1501	08(099)23	1563	08(101)23	4603	08(092)23 08(100)23	PH2CVZ40	08(092)23 08(093)23
1502	08(098)23 08(099)23	2200	08(098)23 08(100)23	4629	08(100)23		08(095)23 08(097)23 08(101)23
1512	08(094)23 08(096)23	4212	08(099)23	4705	08(098)23	PH2NLZ40	08(094)23 08(096)23
1513	08(094)23 08(097)23	4213	08(099)23	4706	08(097)23		08(097)23 08(098)23 08(099)23
1519	08(092)23 08(100)23	4218	08(093)23	4714	08(097)23	PH2CMN40	08(092)23 08(100)23
1537	08(092)23 08(100)23	4226	08(094)23 08(096)23 08(097)23	4719	08(092)23 08(100)23	PH4SBY40	08(099)23
1542	08(093)23	4255	08(099)23	4723B	08(101)23	PH5SBH40	08(099)23
1551	08(101)23	4266	08(098)23	4726A	08(098)23		
1552	08(101)23	4274	08(095)23	4803	08(098)23		
1553	08(101)23	4275	08(096)23				

II

CHART CORRECTIONS

***08(092)23 –LEYTE, S. Coast – Legend**

Chart 1519 2Ed 10/30/2021 [WGS-84 Datum] Last NM 02(024)23

Replace legend, Lepanto with Lipanto	at	10°13.57'N 125°06.74'E
Replace legend, Donan with Dan-an	at	09°58.90'N 125°13.06'E
Replace legend, Anilan with Anilao	at	10°08.86'N 125°07.84'E
Replace legend, Agayay with Agay-ay	at	10°15.32'N 125°12.81'E
Replace legend, Panas with Ambao	at	10°18.91'N 124°57.95'E
Chart 1537 2Ed 12/20/2022 [WGS-84 Datum] Last NM 03(038)23		
Replace legend, Lepanto with Lipanto	at	10°13.55'N 125°06.79'E
Replace legend, Donan with Dan-an	at	09°58.90'N 125°13.06'E
Replace legend, Anilan with Anilao	at	10°08.86'N 125°07.84'E
Replace legend, Agayay with Agay-ay	at	10°15.32'N 125°12.81'E
Replace legend, Panas with Ambao	at	10°18.91'N 124°57.95'E

Chart 4603 1Ed 09/22/1958 Revised 09/1975 [Luzon Datum] Last NM 10(053)22

Replace legend, Lepanto with Lipanto	at	10°13.5'N 125°06.5'E
Replace legend, Agayay with Agay-ay	at	10°15.7'N 125°12.8'E

Chart 4719 1Ed 07/1961 Revised 02/1985 [Luzon Datum] Last NM 03(038)23

Replace legend, Lepanto with Lipanto	at	10°13.6'N 125°08.0'E
--------------------------------------	----	----------------------

ENCs Affected: PH2CVZ40, PH2CMN40

(PSA Philippine Standard Geographic Code; HD 319, 327, 352, 360, and 412/23)

***08(093)23 – LUZON, SE. Coast – Legend**

Chart 1542 1Ed 02/02/2012 Rev 07/31/2012 [WGS-84 Datum] Last NM 01(006)23

Replace legend, Kandalapdap with Candalapdap	at	13°55.85'N 122°29.78'E
--	----	------------------------

Chart 4218 1Ed 03/1958 Rev 09/15/1986 [Luzon Datum] Last NM 04(050)23

Replace legend, Kandalapdap with Candalapdap	at	13°55.79'N 122°29.85'E
--	----	------------------------

ENCs Affected PH2CVZ40

(PSA Philippine Standard Geographic Code; HD 449/23)

***08(094)23 – Luzon, E. Coast, Polillo Strait – Legend**

Chart 1512 1Ed 25/04/2022 [WGS-84 Datum] Last NM 10(041)22

Replace legend, Misua R with Miswa R	at	14°42.18'N 121°41.38'E
--------------------------------------	----	------------------------

Replace legend, Misua with Abiawin

at 14°44.68'N 121°40.07'E

Chart 1513 1Ed 11/05/2020 [WGS-84 Datum] Last NM 03(035)23

Replace legend, Ablawin with Abiawin	at	14°44.68'N 121°40.07'E
--------------------------------------	----	------------------------

Chart 4226 1Ed 08/14/1961 Rev 01/22/1979 [Luzon Datum] Last NM 03(035)23

Replace legend, Misua with Abiawin	at	14°44.77'N 121°40.00'E
------------------------------------	----	------------------------

Replace legend, Misua R with Miswa R

at 14°42.26'N 121°41.30'E

ENCs Affected: PH2NLZ40

(PSA Philippine Standard Geographic Code; HD 435/23)

II

CHART CORRECTIONS

***08(095)23 – Luzon, SE. Coast, Calambayongan I – Legend**

Chart 4274 1Ed 08/28/1967 Rev 06/26/1978 [Luzon Datum] Last NM 03(012)21
 Replace legend, Calambayanga I with Calambayongan I at 14°18'42.75"N 122°39'16.79"E

ENCs Affected: PH2CVZ40
 (PSA Philippine Standard Geographic Code; HD 435/23)

***08(096)23 – Luzon, SE. Coast, Polillo I – Legend**

Chart 1512 1Ed 25/04/2022 [WGS-84 Datum] Last NM 08(094)22
 Replace legend, *Kalobagus R* with *Kalubakis R* at 14°39.13'N 121°54.96'E

Chart 4226 1Ed 08/14/1961 Rev 01/22/1979 [Luzon Datum] Last NM 08(094)22
 Replace legend, *Kalobagus R* with *Kalubakis R* at 14°39.22'N 121°54.88'E

Chart 4275 1Ed 09/1961 Rev 09/25/1978 [Luzon Datum] Last NM 10(041)22
 Replace legend, *Kalobagus R* with *Kalubakis R* at 14°39'13.19"N 121°54'52.61"E

Replace legend, Kalobagus Pt with Kalubakis Pt at 14°38'32.15"N 121°55'01.07"E

ENCs Affected: PH2NLZ40
 (PSA Philippine Standard Geographic Code; HD 435/23)

***08(097)23 – LUZON, SE. Coast, Alabat Island – Legend**

Chart 1513 1Ed 11/05/2020 [WGS-84 Datum] Last NM 08(094)22
 Replace legend, Baliscan I to Baliscar I at 14°14.58'N 121°53.05'E

Chart 4226 1Ed 08/14/1961 Rev 01/22/1979 [Luzon Datum] Last NM 08(096)23
 Replace legend, Baliscan I to Baliscar I at 14°14.62'N 121°54.00'E

Chart 4706 2Ed 12/2010 [WGS-84 Datum] Last NM 07(082)23
 Replace legend, Baliscan I to Baliscar I at 14°14.6'N 121°53.1'E

Chart 4714 1Ed 09/14/1959 Rev 03/31/1986 [Luzon Datum] Last NM 06(076)23
 Replace legend, Baliscan I to Baliscar I at 14°14.4'N 121°53.9'E

ENCs Affected PH2CVZ40
 (Perez, Quezon S.B. Resolution No. 2023-089; HD 512/23)

***08(098)23 – LUZON, W. Coast, Port Masinloc – Wreck. Depth. Rock. Dolphin. Tower. Post. Marine Reserve. Buoy. Overhead Power Cable. Fish Trap. Legend**

Chart 1502 2Ed 09/28/2021 [WGS-84 Datum] Last NM 05(057)23

Insert  at 15°31.88'N 119°55.55'E



at 15°31.18'N 119°57.93'E
 15°31.06'N 119°57.66'E

6₉

at 15°32.64'N 119°55.30'E

1₈

at 15°34.12'N 119°56.27'E

3₃

at 15°33.76'N 119°56.76'E

II CHART CORRECTIONS

***08(098)23 – LUZON, W. Coast, Port Masinloc – Wreck. Depth. Rock. Dolphin. Tower. Post. Marine Reserve. Buoy. Overhead Power Cable. Fish Trap. Legend (continued)**

	at	15°34.26'N 119°54.87'E
		15°30.97'N 119°57.08'E
	at	15°34.04'N 119°55.57'E
	at	15°33.80'N 119°56.99'E
	at	15°32.82'N 119°56.40'E
		15°32.74'N 119°56.50'E
	joining	15°31.27'N 119°55.97'E
	joining	15°31.15'N 119°56.29'E
		15°31.05'N 119°56.66'E
		15°30.98'N 119°56.85'E
		15°30.88'N 119°57.09'E
		15°30.79'N 119°57.29'E
		15°30.69'N 119°57.48'E
	joining	15°28.62'N 119°54.02'E
		15°28.65'N 119°51.67'E
		15°34.37'N 119°54.35'E
		15°34.33'N 119°55.00'E
	at	15°31.53'N 119°52.83'E
	at	15°33.85'N 119°55.08'E
		15°33.90'N 119°55.41'E
Replace		
	at	15°32.02'N 119°55.60'E
27	with	15 ₇
Chart 4266 1ED 09/16/1968 [LUZON Datum] Last NM 01(005)20	at	15°32'58.4"N 119°56'09.1"E
Insert	at	15°31'59.0"N 119°55'27.9"E
	at	15°31'16.5"N 119°57'51.4"E
	at	15°31'09.1"N 119°57'34.3"E
6 ₉	at	15°32'44.4"N 119°55'12.1"E
1 ₈	at	15°34'13.0"N 119°56'11.2"E
3 ₃	at	15°33'51.7"N 119°56'40.3"E
15 ₇	at	15°32'07.0"N 119°55'31.0"E
3 ₃	at	15°30'33.0"N 119°55'34.5"E

II

CHART CORRECTIONS

***08(098)23 – LUZON, W. Coast, Port Masinloc – Wreck. Depth. Rock. Dolphin. Tower. Post. Marine Reserve. Buoy. Overhead Power Cable. Fish Trap. Legend (continued)**





Post (Electric)

Post (submerged)

Post (Ru)

Dn (Ru)

Dn

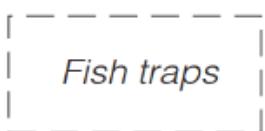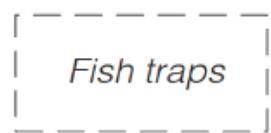

at 15°34'21.3"N 119°54'47.0"E
 15°31'04.2"N 119°56'59.9"E

at 15°33'38.6"N 119°56'38.0"E

at 15°34'08.3"N 119°55'29.3"E

at 15°33'51.2"N 119°56'56.9"E
 15°31'17.7"N 119°55'51.7"E
 15°33'53.8"N 119°56'54.3"E

at 15°32'59.9"N 119°56'15.1"E

at 15°32'56.5"N 119°56'19.8"E
 15°32'55.2"N 119°56'18.8"E
 15°32'51.8"N 119°56'24.0"E
 15°32'50.0"N 119°56'25.0"E

joining 15°31'32.9"N 119°55'43.0"E
 15°31'22.2"N 119°55'53.0"E
 15°31'15.2"N 119°56'12.5"E
 15°31'08.9"N 119°56'34.6"E
 15°31'04.9"N 119°56'45.7"E
 15°30'58.9"N 119°57'00.2"E
 15°30'53.2"N 119°57'12.3"E
 15°30'47.4"N 119°57'23.6"E
 15°30'33.9"N 119°57'36.0"E

joining 15°34'06.4"N 119°55'53.7"E
 15°34'11.8"N 119°56'05.4"E
 15°34'07.7"N 119°56'11.7"E
 15°34'11.4"N 119°56'25.0"E
 15°34'02.6"N 119°56'36.6"E
 15°33'51.5"N 119°56'36.1"E
 15°33'50.8"N 119°56'19.9"E
 15°33'56.7"N 119°56'11.2"E
 15°33'54.0"N 119°56'01.7"E
 15°34'01.0"N 119°55'54.1"E
 15°34'06.4"N 119°55'53.7"E

joining 15°30'46.1"N 119°57'01.3"E
 15°30'46.2"N 119°57'15.5"E
 15°30'43.2"N 119°57'20.8"E
 15°30'31.2"N 119°57'24.5"E
 15°30'28.3"N 119°57'18.8"E
 15°30'40.2"N 119°57'08.1"E
 15°30'40.2"N 119°56'57.7"E
 15°30'46.1"N 119°57'01.3"E

joining 15°30'27.7"N 119°56'05.6"E
 15°30'29.5"N 119°56'09.7"E
 15°30'27.3"N 119°56'12.8"E
 15°30'18.3"N 119°56'16.0"E
 15°30'17.3"N 119°56'10.4"E
 15°30'25.4"N 119°56'06.2"E
 15°30'27.7"N 119°56'05.6"E

II

CHART CORRECTIONS

***08(098)23 – LUZON, W. Coast, Port Masinloc – Wreck. Depth. Rock. Dolphin. Tower. Post. Marine Reserve. Buoy. Overhead Power Cable. Fish Trap. Legend**

(continued)



joining	15°29'53.9"N 119°56'14.7"E 15°29'50.6"N 119°56'17.7"E 15°29'50.7"N 119°56'05.5"E 15°29'52.2"N 119°56'05.7"E 15°29'54.3"N 119°56'08.8"E 15°29'53.9"N 119°56'14.7"E
---------	--

— — — *MR* — — —

joining	15°28'42.9"N 119°53'56.0"E 15°28'44.9"N 119°51'35.0"E 15°34'27.9"N 119°54'16.0"E 15°34'25.9"N 119°54'55.0"E
---------	--

Masinloc and Oyon Bay Marine Reserve



at	15°31'38.0"N 119°52'45.0"E
----	----------------------------

Delete legend Masinloc Harbor

at	15°31'08.0"N 119°58'12.0"E
----	----------------------------

Delete legend Tagapolo Pt

at	15°32'02.0"N 119°56'41.0"E
----	----------------------------

Replace Benguet Consolidated Mining Company with Port of Baloganon

at	15°32'53.0"N 119°56'40.0"E
----	----------------------------

Pilapir Island with Pirapir Island

at	15°30'57.0"N 119°56'59.0"E
----	----------------------------

Chart 4705 3ED 03/2010 [WGS-84 Datum] Last NM 05(069)23

Insert — — — *MR* — — — joining

15°28.62'N 119°54.02'E 15°28.65'N 119°51.67'E 15°34.37'N 119°54.35'E 15°34.33'N 119°55.00'E
--

Masinloc and Oyon Bay Marine Reserve

Chart 4726A 4ED 01/30/2018 [WGS-84 Datum] Last NM 05(063)23

Insert — — — *MR* — — — joining

15°28.6'N 119°54.0'E 15°28.7'N 119°51.7'E 15°34.4'N 119°54.4'E 15°34.3'N 119°55.0'E
--

Masinloc and Oyon Bay Marine Reserve

Chart 4803 1ED 12/2006 [WGS-84 Datum] Last NM 03(044)23

Insert — — — *MR* — — — joining

15°28.62'N 119°54.02'E 15°28.65'N 119°51.67'E 15°34.37'N 119°54.35'E 15°34.33'N 119°55.00'E
--

Masinloc and Oyon Bay Marine Reserve

II

CHART CORRECTIONS

***08(098)23 – LUZON, W. Coast, Port Masinloc – Wreck. Depth. Rock. Dolphin. Tower. Post. Marine Reserve. Buoy. Overhead Power Cable. Fish Trap. Legend** (continued)

Chart 2200 1ED 08/28/2020 [WGS-84 Datum] Last NM 05(073)23

Insert joining

15°28.6'N 119°54.0'E
15°28.7'N 119°51.7'E
15°34.4'N 119°54.4'E
15°34.3'N 119°55.0'E

— — — MR — — —

*Masinloc and Oyon Bay
Marine Reserve*

at

15°31.5'N 119°52.8'E

ENC Affected: PH2NLZ40

(NAMRIA Survey Report, Malacañang Proc. No. 231, s. 1993; HD 272/23)

***08(099)23 – LUZON, W. Coast, Subic Bay - Buoys**

Chart 1501 2Ed 05/12/2021 [WGS-84 Datum] Last NM

Insert



at

14°48.38'N 120°17.64'E
14°48.33'N 120°17.65'E

Chart 1502 2Ed 09/28/2021 [WGS-84 Datum] Last NM 08(098)23

Insert



at

14°48.38'N 120°17.64'E
14°48.33'N 120°17.65'E

Chart 4212 2Ed 11/29/2022 [WGS-84 Datum] Last NM 05(057)23

Insert



at

14°48'22.6"N 120°17'38.7"E
14°48'20.1"N 120°17'39.0"E

Chart 4213 2Ed 11/29/22 [WGS-84 Datum] Last NM 02(024)23

Insert



at

14°48'22.6"N 120°17'38.7"E
14°48'20.1"N 120°17'39.0"E

Chart 4215 1Ed 04/29/2022 [WGS-84 Datum] Last NM 03(040)23

Insert



at

14°48'22.6"N 120°17'38.7"E
14°48'20.1"N 120°17'39.0"E

Chart 4255 2Ed 01/1975 Rev 06/1985 [LUZON Datum] Last NM 06(078)23

Insert



at

14°48.47'N 120°17.56'E
14°48.43'N 120°17.57'E

ENC Affected: PH5SBH40, PH4SBY40, PH2NLZ40

(PCG NOTAM-ATON 042-2023: HD 436/23)

II
CHART CORRECTIONS

***08(100)23 – MAASIN TO IPIL, Bohol Sea – Submarine Cable**

Chart 1519 2Ed 09/30/2021 [WGS-84 Datum] Last NM 08(092)23

Insert



joining

09°59.61'N 124°57.01'E
09°58.25'N 124°57.92'E
09°53.49'N 125°02.34'E
09°53.18'N 125°02.95'E
09°53.19'N 125°03.50'E
09°52.98'N 125°03.91'E
09°52.23'N 125°04.50'E
09°51.06'N 125°06.69'E
09°50.67'N 125°09.04'E
09°50.21'N 125°09.67'E
09°49.58'N 125°09.98'E
09°49.17'N 125°10.55'E
09°48.00'N 125°18.60'E
09°47.88'N 125°21.74'E
09°48.04'N 125°23.81'E
09°48.01'N 125°25.11'E
09°47.78'N 125°25.97'E
09°47.54'N 125°26.37'E

Chart 1537 2Ed 12/20/2022 [WGS-84 DATUM] Last NM 08(092)23

Insert



joining

10°07.74'N 124°51.70'E
10°07.30'N 124°51.46'E
10°07.03'N 124°51.23'E
10°06.70'N 124°50.76'E
10°06.47'N 124°50.62'E
10°06.20'N 124°50.60'E
10°05.62'N 124°50.83'E
10°05.03'N 124°51.46'E
10°03.70'N 124°51.96'E
10°02.73'N 124°52.64'E
10°02.54'N 124°53.15'E
10°02.71'N 124°54.60'E
10°02.45'N 124°55.32'E
10°01.70'N 124°56.10'E
09°59.61'N 124°57.01'E
09°58.25'N 124°57.92'E
09°53.49'N 125°02.34'E
09°53.18'N 125°02.95'E
09°53.19'N 125°03.50'E
09°52.98'N 125°03.91'E
09°52.23'N 125°04.50'E
09°51.06'N 125°06.69'E
09°50.67'N 125°09.04'E
09°50.21'N 125°09.67'E
09°49.58'N 125°09.98'E
09°49.17'N 125°10.55'E
09°48.00'N 125°18.60'E
09°47.88'N 125°21.74'E
09°48.04'N 125°23.81'E
09°48.01'N 125°25.11'E
09°47.78'N 125°25.97'E
09°47.54'N 125°26.37'E

II

CHART CORRECTIONS

***08(100)23 – MAASIN TO IPIL, Bohol Sea – Submarine Cable**

(continued)

Chart 2200 1ED 08/28/2020 [WGS-84 Datum] Last NM 08(098)23

Insert



joining

10°07.7'N 124°51.7'E
10°06.2'N 124°50.6'E
10°02.7'N 124°52.6'E
10°02.5'N 124°55.3'E
09°53.5'N 125°02.3'E
09°50.2'N 125°09.7'E
09°49.2'N 125°10.6'E
09°47.5'N 125°26.4'E

Chart 4603 1Ed 09/22/1958 Rev 09/08/1975 [Luzon Datum] Last NM 08(092)23

Insert



joining

10°07.81'N 124°51.61'E
10°07.37'N 124°51.38'E
10°07.10'N 124°51.14'E
10°06.77'N 124°50.68'E
10°06.53'N 124°50.54'E
10°06.26'N 124°50.52'E
10°05.69'N 124°50.74'E
10°05.10'N 124°51.38'E
10°03.77'N 124°51.88'E
10°02.80'N 124°52.56'E
10°02.60'N 124°53.07'E
10°02.78'N 124°54.52'E
10°02.52'N 124°55.24'E
10°01.77'N 124°56.01'E
09°59.68'N 124°56.93'E
09°58.32'N 124°57.83'E
09°53.56'N 125°02.26'E
09°53.25'N 125°02.87'E
09°53.26'N 125°03.41'E
09°53.05'N 125°03.83'E
09°52.30'N 125°04.41'E
09°51.13'N 125°06.61'E
09°50.74'N 125°08.95'E
09°50.28'N 125°09.58'E
09°49.65'N 125°09.89'E
09°49.23'N 125°10.47'E
09°48.07'N 125°18.51'E
09°47.95'N 125°21.65'E
09°48.11'N 125°23.73'E
09°48.07'N 125°25.03'E
09°47.85'N 125°25.88'E
09°47.60'N 125°26.29'E

Chart 4629 3Ed 12/05/1994 [Luzon Datum] Last NM 10(053)22

Insert



joining

09°48.08'N 125°23.37'E
09°48.11'N 125°23.73'E
09°48.07'N 125°25.03'E
09°47.85'N 125°25.88'E
09°47.60'N 125°26.29'E

Chart 4708 2Ed 11/2010 [WGS-84 Datum] Last NM 07(084)23

Insert



joining

10°07.7'N 124°51.7'E
10°06.2'N 124°50.6'E
10°05.0'N 124°51.5'E
10°02.7'N 124°52.6'E
10°02.5'N 124°55.3'E
09°59.6'N 124°57.0'E

II CHART CORRECTIONS

***08(100)23 – MAASIN TO IPIL, Bohol Sea – Submarine Cable**

Chart 4719 1Ed 07/24/1961 Rev 02/12/1985 [Luzon Datum] Last NM 08(092)23
Insert  joining

(continued)

09°53.5'N 125°02.3'E
09°53.0'N 125°03.9'E
09°51.1'N 125°06.7'E
09°50.2'N 125°09.7'E
09°49.2'N 125°10.6'E
09°48.0'N 125°18.6'E
09°48.0'N 125°23.8'E
09°47.5'N 125°26.4'E

10°07.8'N 124°51.6'E
10°06.3'N 124°50.5'E
10°05.1'N 124°51.4'E
10°02.8'N 124°52.6'E
10°02.5'N 124°55.2'E
09°59.7'N 124°56.9'E
09°53.6'N 125°02.3'E
09°53.0'N 125°03.8'E
09°51.1'N 125°06.6'E
09°50.3'N 125°09.6'E
09°49.2'N 125°10.5'E
09°48.1'N 125°18.5'E
09°48.1'N 125°23.7'E
09°47.6'N 125°26.3'E

ENC's Affected: PH2CMN40

(Owned by Globe, Eastern Telecom PI and Infinivan; HD 656/22)

***08(101)23 – PALAWAN TO BATANGAS, Sulu Sea – Pipeline. Offshore Platform**

Chart 1551 1Ed 02/29/2012 [WGS-84 Datum] Last NM 11(064)22

Insert



joining

11°36.73'N 120°12.00'E
11°37.64'N 120°13.44'E
11°38.45'N 120°14.82'E
11°39.14'N 120°15.54'E
11°39.42'N 120°16.12'E
11°39.82'N 120°17.90'E
11°40.50'N 120°19.34'E
11°41.42'N 120°20.34'E
11°41.64'N 120°20.84'E
11°42.25'N 120°22.55'E
11°42.44'N 120°23.85'E
11°43.84'N 120°26.92'E
11°47.17'N 120°36.12'E
11°47.20'N 120°38.22'E
11°49.34'N 120°46.00'E
11°56.00'N 120°56.67'E
11°56.17'N 120°57.25'E
11°56.55'N 120°59.59'E
11°56.82'N 121°02.15'E
11°57.29'N 121°03.17'E
11°58.00'N 121°03.92'E
12°02.00'N 121°06.63'E

II CHART CORRECTIONS

*08(101)23 – PALAWAN TO BATANGAS, Sulu Sea – Pipeline. Offshore Platform		(continued)
Delete	<i>Gas (see Note)</i>	joining
		12°02.00'N 121°06.60'E
		12°00.35'N 121°05.50'E
		11°57.97'N 121°03.87'E
		11°57.42'N 121°03.31'E
		11°57.04'N 121°02.67'E
		11°56.81'N 121°02.07'E
		11°56.55'N 120°59.50'E
		11°56.15'N 120°57.21'E
		11°55.96'N 120°56.64'E
		11°55.72'N 120°56.21'E
		11°49.25'N 120°45.89'E
		11°47.02'N 120°38.48'E
		11°46.98'N 120°36.40'E
		11°43.63'N 120°27.23'E
		11°42.23'N 120°24.16'E
		11°42.05'N 120°22.85'E
		11°41.52'N 120°21.38'E
		11°41.21'N 120°20.64'E
		11°40.29'N 120°19.63'E
		11°39.61'N 120°18.20'E
		11°39.22'N 120°16.44'E
		11°38.93'N 120°15.84'E
		11°38.25'N 120°15.13'E
		11°37.26'N 120°13.47'E
		11°36.33'N 120°12.00'E
Chart 1552 1 Ed 02/29/2012 [WGS-84 Datum] Last NM 11(064)22		
Insert	<i>Gas (see Note)</i>	joining
		11°45.00'N 120°30.13'E
		11°47.17'N 120°36.12'E
		11°47.20'N 120°38.22'E
		11°49.34'N 120°46.00'E
		11°56.00'N 120°56.67'E
		11°56.17'N 120°57.25'E
		11°56.55'N 120°59.59'E
		11°56.82'N 121°02.15'E
		11°57.29'N 121°03.17'E
		11°58.00'N 121°03.92'E
		12°04.29'N 121°08.19'E
		12°04.95'N 121°09.01'E
Delete		joining
		12°04.96'N 121°09.01'E
		12°04.62'N 121°08.52'E
		12°04.29'N 121°08.19'E
		12°03.35'N 121°07.50'E
		12°00.56'N 121°05.65'E
		11°57.94'N 121°03.86'E
		11°57.42'N 121°03.31'E
		11°57.26'N 121°03.07'E
		11°57.04'N 121°02.66'E
		11°56.79'N 121°02.01'E
		11°56.65'N 121°00.75'E
		11°56.55'N 120°59.55'E
		11°56.16'N 120°57.29'E
		11°55.92'N 120°56.54'E
		11°49.25'N 120°45.87'E
		11°47.02'N 120°38.48'E
		11°46.98'N 120°36.41'E
		11°45.43'N 120°32.20'E
		11°45.00'N 120°31.03'E

II

CHART CORRECTIONS

***08(101)23 – PALAWAN TO BATANGAS, Sulu Sea – Pipeline. Offshore Platform** **(continued)**
 Chart 1553 1Ed 02/16/22 [WGS-84 Datum] Last NM 03(046)23

Insert



Gas (see Note)

joining

11°35.39'N 119°28.01'E
 11°38.17'N 119°37.59'E
 11°40.00'N 119°42.17'E
 11°40.25'N 119°44.59'E
 11°40.39'N 119°45.94'E
 11°40.29'N 119°46.70'E
 11°39.75'N 119°48.12'E
 11°39.42'N 119°50.59'E
 11°37.95'N 119°56.09'E
 11°36.92'N 119°58.17'E
 11°36.25'N 120°00.24'E
 11°34.04'N 120°03.59'E
 11°33.47'N 120°05.02'E
 11°33.42'N 120°06.67'E
 11°33.50'N 120°07.37'E
 11°33.80'N 120°08.14'E
 11°34.35'N 120°08.92'E
 11°34.84'N 120°09.25'E
 11°35.59'N 120°09.75'E
 11°36.15'N 120°11.09'E
 11°37.64'N 120°13.44'E
 11°38.45'N 120°14.82'E
 11°39.14'N 120°15.54'E
 11°39.42'N 120°16.12'E
 11°39.82'N 120°17.90'E
 11°40.50'N 120°19.34'E
 11°41.42'N 120°20.34'E
 11°41.64'N 120°20.84'E
 11°42.25'N 120°22.55'E
 11°42.44'N 120°23.85'E
 11°43.84'N 120°26.92'E
 11°44.95'N 120°30.00'E

Delete



joining

11°44.64'N 120°30.00'E
 11°43.63'N 120°27.23'E
 11°42.23'N 120°24.16'E
 11°42.05'N 120°22.85'E
 11°41.52'N 120°21.38'E
 11°41.21'N 120°20.64'E
 11°40.29'N 120°19.63'E
 11°39.61'N 120°18.20'E
 11°39.22'N 120°16.44'E
 11°38.93'N 120°15.84'E
 11°38.25'N 120°15.13'E
 11°37.26'N 120°13.47'E
 11°35.93'N 120°11.37'E
 11°35.37'N 120°10.06'E
 11°34.15'N 120°09.24'E
 11°33.58'N 120°08.43'E
 11°33.30'N 120°07.68'E
 11°33.22'N 120°07.01'E
 11°33.27'N 120°05.32'E
 11°33.83'N 120°03.88'E
 11°36.06'N 120°00.53'E
 11°36.73'N 119°58.46'E
 11°37.75'N 119°56.38'E
 11°39.22'N 119°50.88'E
 11°39.54'N 119°48.47'E

II

CHART CORRECTIONS

***08(101)23 – PALAWAN TO BATANGAS, Sulu Sea – Pipeline. Offshore Platform (continued)**

11°40.08'N 119°47.03'E
 11°40.18'N 119°46.26'E
 11°39.80'N 119°42.51'E
 11°38.02'N 119°38.06'E
 11°35.10'N 119°28.01'E

Chart 1563 1Ed 12/26/2019 [WGS-84 Datum] Last NM 03(046)23

Insert



joining

11°38.55'N 118°54.39'E
 11°38.34'N 118°56.70'E
 11°37.90'N 118°57.77'E
 11°36.87'N 118°59.34'E
 11°34.67'N 119°02.09'E
 11°31.67'N 119°06.09'E
 11°31.45'N 119°07.07'E
 11°30.84'N 119°07.39'E
 11°30.50'N 119°08.59'E
 11°29.50'N 119°09.34'E
 11°29.25'N 119°09.59'E
 11°29.09'N 119°10.09'E
 11°29.00'N 119°10.49'E
 11°29.09'N 119°10.92'E
 11°29.67'N 119°13.59'E
 11°34.25'N 119°24.07'E
 11°38.17'N 119°37.59'E
 11°40.00'N 119°42.17'E
 11°40.09'N 119°43.00'E

Delete



joining

11°44.64'N 120°30.00'E
 11°43.63'N 120°27.23'E
 11°42.23'N 120°24.16'E
 11°42.05'N 120°22.85'E
 11°41.52'N 120°21.38'E
 11°41.21'N 120°20.64'E
 11°40.29'N 120°19.63'E
 11°39.61'N 120°18.20'E
 11°39.22'N 120°16.44'E
 11°38.93'N 120°15.84'E
 11°38.25'N 120°15.13'E
 11°37.26'N 120°13.47'E
 11°35.93'N 120°11.37'E
 11°35.37'N 120°10.06'E
 11°34.15'N 120°09.24'E
 11°33.58'N 120°08.43'E
 11°33.30'N 120°07.68'E
 11°33.22'N 120°07.01'E
 11°33.27'N 120°05.32'E
 11°33.83'N 120°03.88'E
 11°36.06'N 120°00.53'E
 11°36.73'N 119°58.46'E
 11°37.75'N 119°56.38'E
 11°39.22'N 119°50.88'E
 11°39.54'N 119°48.47'E
 11°40.08'N 119°47.03'E
 11°40.18'N 119°46.26'E
 11°39.80'N 119°42.51'E
 11°38.02'N 119°38.06'E
 11°35.10'N 119°28.01'E

II

CHART CORRECTIONS

***08(101)23 – PALAWAN TO BATANGAS, Sulu Sea – Pipeline. Offshore Platform (continued)**

Move	Pandan	<input type="checkbox"/>	from	11° 28.16'N 119° 00.13'E
			to	11° 26.16'N 119° 00.13'E

Chart 4723B 2Ed 04/20/2023 [WGS-84 Datum]

Insert		joining	11°38.6'N 118°54.4'E 11°37.9'N 118°57.8'E 11°31.7'N 119°06.1'E 11°31.5'N 119°07.1'E 11°30.8'N 119°07.4'E 11°30.5'N 119°08.6'E 11°29.3'N 119°09.6'E 11°29.0'N 119°10.5'E 11°29.7'N 119°13.6'E 11°34.3'N 119°24.1'E 11°38.2'N 119°37.6'E 11°40.0'N 119°42.2'E 11°40.4'N 119°45.9'E 11°39.8'N 119°48.1'E 11°38.0'N 119°56.1'E 11°36.3'N 120°00.2'E 11°33.5'N 120°05.0'E 11°33.5'N 120°07.4'E 11°34.4'N 120°08.9'E 11°35.6'N 120°09.8'E 11°36.2'N 120°11.1'E 11°38.5'N 120°14.8'E 11°39.4'N 120°16.1'E 11°40.5'N 120°19.3'E 11°41.6'N 120°20.8'E 11°42.4'N 120°23.9'E 11°47.2'N 120°36.1'E 11°47.2'N 120°38.2'E 11°49.3'N 120°46.0'E 11°56.0'N 120°56.7'E 11°56.6'N 121°00.0'E
Delete		joining	11°38.4'N 118°55.4'E 11°38.4'N 118°56.8'E 11°37.9'N 118°57.9'E 11°29.2'N 119°09.4'E 11°29.1'N 119°11.1'E 11°29.7'N 119°14.0'E 11°34.3'N 119°24.1'E 11°37.9'N 119°38.0'E 11°39.8'N 119°42.9'E 11°40.1'N 119°46.8'E 11°39.4'N 119°48.9'E 11°39.4'N 119°50.1'E 11°38.2'N 119°55.0'E 11°36.0'N 120°00.6'E 11°34.1'N 120°03.4'E 11°33.3'N 120°05.3'E 11°33.3'N 120°07.9'E 11°34.0'N 120°09.3'E 11°35.4'N 120°10.3'E 11°38.1'N 120°15.1'E 11°38.9'N 120°15.9'E 11°39.5'N 120°17.4'E 11°39.5'N 120°18.2'E

II

CHART CORRECTIONS

***08(101)23 – PALAWAN TO BATANGAS, Sulu Sea – Pipeline. Offshore Platform (continued)**

11°40.2'N 120°19.7'E
11°41.4'N 120°20.9'E
11°42.1'N 120°23.3'E
11°42.5'N 120°24.9'E
11°43.2'N 120°26.4'E
11°47.0'N 120°36.7'E
11°47.1'N 120°39.0'E
11°49.3'N 120°46.2'E
11°56.0'N 120°56.7'E
11°56.4'N 121°00.0'E

Note: The 500-meter buffer of submarine pipeline will be reinserted

ENC's Affected: PH2CVZ40

(Notice to Mariners No. 05(121)02, Notice to Mariners No. *03(028)15 & Technical Report; HD 092/01, HD 039/15, & HD 467/23)

III

TEMPORARY AND PRELIMINARY NOTICES

No Temporary or Preliminary Notice for this month.

IV

LIST OF LIGHTS CORRECTIONS

LIGHTHOUSES

NUMBER	NAME	POSITION	CHARACTERISTICS	Elev(m)	Range (NM)	STRUCTURE	REMARKS
(1)	(2)	(3)	(4)	(5)	(6)	(7)	(8)
REGION IV-A - CALABARZON							
QUEZON							
0117	F2750	BALISCAR ISLAND	14 14 40 N 121 53 58 E	Fl W 5s	17	12	White concrete column, 9
*							

Note: Asterisk (*) indicates new information in the column above it

LIGHTED BUOYS

NUMBER	NAME	POSITION	CHARACTERISTICS	Elev(m)	Range (NM)	STRUCTURE	REMARKS
(1)	(2)	(3)	(4)	(5)	(6)	(7)	(8)
<i>SSYHI Mooring Buoy 1</i>							
*		14 48 23 N 120 17 39 E	Fl(8)Y 15s			Yellow. Cylindrical	In WGS-84 Datum
<i>SSYHI Mooring Buoy 2</i>							
*		14 48 20 N 120 17 39 E	Fl(8)Y 15s			Yellow. Cylindrical	In WGS-84 Datum
*		*	*	*		*	*

Note: Asterisk (*) indicates new information in the column above it

V

COAST PILOT CORRECTIONS

Philippine Coast Pilot, 7th Ed. Volume 1

Chapter 5 – LUZON ISLAND

- Page 5-27, left column, line 43-45. A proclamation declared Oyon Bay and Port Masinloc as marine protected areas. Activities that may harm the environment are strictly prohibited in these areas.
Delete:
- Page 5-27, left column, line 46. **Marine Protected Area** - By virtue of Malacañang Proclamation No. 231, s. 1993, the coastal area and island within Masinloc and Oyon Bay, Zambales is considered Marine Reserve, from Bani point to Matalvi Pt. Activities that may harm the environment are strictly prohibited in these areas.
Insert:
- Page 5-27, left column, line 47-49. **Prominent Features** in the area includes two (2) tall red and white chimney of power plant located about 0.5 mile and 0.15mile E of Bani point. There are also power transmission line pylons and cellular networks towers around the same area.
Replace:
- Page 5-27, left column, line 53-54. at VFH channel 16. Plots can also be contacted thru telefax number (+6347)307-5193
Replace:
- Page 5-27, left column, line 60. anchoring. Pilotage operating hours is strictly from 0600H-1600H only. Pilot boards (15°32.971 N., 119°53.000 E) at the position 2 miles NW of Alupihing Point.
right column, line 1.
Replace:
- Page 5-27, right column, line 6. 0.5 mile wide, having depth of 9.9m to 16.8m (5.41fm to 9.19 fm),
Replace:
- Page 5-27 right column, line 35-36. Matalvi, is fringed by reefs and foul ground that extends to approximately 0.22-mile to 0.4-mile.
Replace:
- Page 5-27, right column, line 47-52. On Salvador Island. A triangular range marker, painted gray, is displayed at the northern portion of Salvador Island. A black spherical buoy at the northern coast of San Salvador Island marks the edge of the fringed reef.
Replace:
- Page 5-28, left column, line 14-15. Are prominent. The principal trade is fishing, mostly by local residents.
Replace:
- Page 5-28, left column, line 19-21. Fresh water and fuel are available within the locality with arrangement to private supplier/s. Repairs are not obtainable. The nearest repair facility is at Subic Drydock Center, Olongapo City, Zambales. There is an abandoned sawmill on the point of
Replace:
- Page 5-28, left column, line 31-34. Church in the town of Masinloc, Port of Baloganon with a 63.7 m long concrete pier and the depth alongside it is 6.8m. The facility has not been in operation since 2010. About 1.40 miles SE of the church is the Titan Minerals Inc. pier which can accommodate LCTs with LOA of up to 100m. Pilotage is compulsory, extreme caution should be observed as the channel leading to the port is very narrow. With fishing boats occupying majority of the available berthing space, LCT usually docked to port Mediterranean style. Water supply and bunkering can be carried out with arrangements to private supplier/s
Replace:

V
COAST PILOT CORRECTIONS

Page 5-93, right column, line 30. and farther in are Cabalete, Baliscar, and Alabat Islands.
Replace:

Page 5-96, left column, line 48. **BALISCAR ISLAND**, 1.8 miles WNW of the N point
Replace:

Page 5-96, left column, line 54. sea. The island is marked by Baliscar Island Light ($14^{\circ} 14'$)
Replace:

Page 5-96, left column, line 58. **BALESIN ISLAND** is about 12 miles NE of Baliscar
Replace:

Page 5-100, left column, line 1. **CALAMBAYONGAN ISLAND** is about 70 m (230 ft)
Replace:

Page 5-100, left column, line 13. the NW end of Calambayongan Island is visible on entering
Replace:

Page 5-100, right column, line 8. wide at the entrance between Calambayongan Island and
Replace:

Page 5-100, right column, line 21. of the iron mines at Larap Peninsula and Calambayongan
Replace:

Page 5-100, right column, line 26. Calambayongan island and the pier and warehouses of Pan
Replace:

Page 5-101, left column, line 41-43. the E tangent of Calambayongan Island. When the N tangent
Replace: of Calambayongan Island bears 234° , pick up the range beacons and steer for it on course 146° , until the beacon on the SE shore of Calambayongan Island bears 248° . Then

VI

NAVIGATIONAL WARNINGS

*See all active Navigational Warnings at
<https://staging.geoportal.gov.ph/nwapp/>*

NAVPHIL 227/21 – LUZON, W. COAST, MANILA BAY – DREDGING WORKS

BOSKALIS PHILIPPINES INC UTILIZING VARIOUS VESSELS AND OFFSHORE EQUIPMENT, IS CONDUCTING DREDGING WORKS UNTIL 31 OCTOBER 2023 AT SAN NICOLAS SHOAL OFF THE PROVINCE OF CAVITE IN THE AREA BOUNDED BY THE FOLLOWING COORDINATES:

14-21-03N 120-41-39E

14-21-03N 120-43-29E

14-26-14N 120-49-18E

14-26-59N 120-48-37E

14-26-59N 120-46-43E.

CANCEL THIS NAVIGATIONAL WARNING ON 01 NOVEMBER 2023.

NAVPHIL 234/21 – LUZON, W. COAST, MANILA BAY – DREDGING WORKS

BOSKALIS PHILIPPINES INC UTILIZING VARIOUS VESSELS AND EQUIPMENT, IS CONDUCTING DREDGING WORKS UNTIL APRIL 2025 OFF THE SHORES OF MANILA AND PASAY WITHIN THE AREA BOUNDED BY THE FOLLOWING COORDINATES:

14-31-58N 120-53-40E

14-33-34N 120-56-56E

14-33-33N 120-58-08E

14-33-04N 120-58-09E

14-32-08N 120-56-10E.

CANCEL THIS NAVIGATIONAL WARNING ON 01 MAY 2025.

NAVPHIL 015/22 – LUZON W. COAST, MANILA BAY – SURVEY WORKS

BOSKALIS PHILIPPINES, INC UTILIZING "ETHELINA VIII" IS CONDUCTING SURVEY ACTIVITIES OFF PASAY CITY IN MANILA BAY FROM 27 JANUARY 2022 TO 30 APRIL 2025 IN THE AREA BOUNDED BY THE FOLLOWING COORDINATES:

14-31-58N 120-53-40E

14-33-34N 120-56-56E

14-33-32N 120-58-08E

14-32-33N 120-58-08E

14-31-34N 120-56-56E

14-32-11N 120-55-51E.

CANCEL THIS NAVIGATIONAL WARNING ON 01 MAY 2025.

NAVPHIL 081/22 – LUZON W. COAST, MANILA BAY – DREDGING WORKS

BEN LINE AGENCIES PHILIPPINES INC UTILIZING VARIOUS VESSELS AND EQUIPMENT, IS CONDUCTING DREDGING WORKS OFF THE SHORES OF TERNATE, CAVITE WITHIN THE AREA BOUNDED BY THE FOLLOWING COORDINATES:

14-15-18N 120-34-55E

14-16-40N 120-35-40E

14-19-07N 120-37-42E

14-21-03N 120-41-39E

14-21-03N 120-43-13E

14-19-34N 120-40-43E

14-18-47N 120-38-39E

14-14-59N 120-35-31E.

CANCEL THIS NAVIGATIONAL WARNING ON 01 JANUARY 2024.

NAVPHIL 172/22 – LUZON, W. COAST, MANILA BAY – DREDGING WORKS

SAN MIGUEL AEROCITY, INC UTILIZING VARIOUS FOREIGN AND LOCAL VESSELS, IS CONDUCTING DREDGING WORKS AT SAN NICOLAS SHOAL UNTIL DECEMBER 2024 WITHIN THE AREA WITH THE FOLLOWING DETAILS:

14-26-54N 120-46-48E

14-26-54N 120-48-42E

14-26-08N 120-49-23E

14-20-58N 120-43-34E

14-20-57N 120-41-44E.

CANCEL THIS NAVIGATIONAL WARNING ON 01 JANUARY 2025.

NAVPHIL 194/22 – MINDORO, N. AND W. COASTS – DRILLING WORKS

TCSC CORP IS CONDUCTING DRILLING WORKS OFF THE SHORE OF OCCIDENTAL MINDORO UNTIL 30 SEPTEMBER 2022 IN THE AREAS BOUNDED BY THE FOLLOWING COORDINATES:

WAWA AREA

13°29-00N 120-43-00E

13°29-30N 120-43-00E

13°29-30N 120-45-00E

13°29-00N 120-47-00E

13°28-30N 120-47-00E

13°28-30N 120-44-30E,

BALAGNAM AREA

13°31-00N 120-33-00E

13°32-00N 120-33-00E

13°32-00N 120-35-00E

13°31-00N 120-39-00E

13°30-00N 120-39-00E

13°30-00N 120-37-00E,

VI

NAVIGATIONAL WARNINGS

MASLUD AREA

13°18-00N 120-27-30E
13°21-00N 120-26-30E
13°24-00N 120-26-30E
13°24-00N 120-27-30E
13°20-00N 120-28-30E
13°18-00N 120-28-30E,
TALABAAN AREA
13°05-00N 120-41-30E
13°08-30N 120-39-00E
13°10-00N 120-39-00E
13°10-00N 120-39-30E
13°06-00N 120-42-00E
13°05-00N 120-42-00E.

CANCEL THIS NAVIGATIONAL WARNING ON
01 OCTOBER 2023.

NAVPHIL 197/22 – LUZON W. COAST, MANILA BAY – DREDGING AND RECLAMATION

BEN LINE AGENCIES PHILIPPINES INC
UTILIZING MULTIPLE VESSELS, IS
CONDUCTING DREDGING AND LAND
RECLAMATION WORKS UNTIL APRIL 2025
OFF THE SHORES OF THE CITIES OF PASAY
AND MANILA IN THE AREA BOUNDED BY THE
FOLLOWING COORDINATES:
14-31-58N 120-53-40E
14-33-34N 120-56-56E
14-33-33N 120-58-08E
14-33-04N 120-58-09E
14-32-08N 120-56-10E.
CANCEL THIS NAVIGATIONAL WARNING ON
01 MAY 2025.

NAVPHIL 198/22 – LUZON W. COAST, MANILA BAY – SITE INVESTIGATION

BEN LINE AGENCIES PHILIPPINES INC
UTILIZING MULTIPLE VESSELS, IS
CONDUCTING SITE INVESTIGATION WORKS
UNTIL DECEMBER 2023 OFF THE SHORES OF
TERNATE AND NAIC, CAVITE WITHIN THE
AREA BOUNDED BY THE FOLLOWING
COORDINATES:
14-15-18N 120-34-55E
14-17-12N 120-36-17E
14-21-03N 120-41-39E
14-21-03N 120-43-13E
14-17-12N 120-37-17E
14-14-59N 120-35-31E.
CANCEL THIS NAVIGATIONAL WARNING ON
01 JANUARY 2024.

NAVPHIL 201/22 – LUZON W. COAST, MANILA BAY – SITE INVESTIGATION

BEN LINE AGENCIES PHILIPPINES INC
UTILIZING MULTIPLE VESSELS IS
CONDUCTING SITE INVESTIGATION AND
DREDGING WORKS UNTIL DECEMBER 2023
OFF THE SHORES OF TANZA AND NAIC,
CAVITE OR WITHIN THE AREA BOUNDED BY
THE FOLLOWING COORDINATES:

14-20-57N 120-41-44E
14-22-35N 120-42-11E
14-24-19N 120-43-24E
14-25-39N 120-44-33E
14-26-59N 120-45-40E
14-26-59N 120-46-43E.

CANCEL THIS NAVIGATIONAL WARNING ON
01 JANUARY 2024.

NAVPHIL 314/22 - LUZON, W. COAST, PASIG RIVER – CONSTRUCTION WORKS

CHART 1501 (INT 4491).
CONSTRUCTION WORKS IN PROGRESS
UNTIL 09 MARCH 2024 IN AREA BOUNDED
BY:

14-35-45N 120-58-53E
14-35-45N 120-58-53E
14-35-47N 120-58-55E
14-35-46N 120-58-55E.

CANCEL THIS MESSAGE 10 MARCH 2024.

NAVPHIL 367/22 - LUZON W. COAST, MANILA BAY AND LUZON SEA - DREDGING AND RECLAMATION ACTIVITY

CHART 1501,1502.
DREDGING AND RECLAMATION ACTIVITY BY
HONG FA 168, HONG FA 169 AND YANG
CHENG 3 UNTIL 31 DEC 2023 IN AREAS
BOUNDED BY:

MANILA BAY AREA
14-33-33N 120-58-38E
14-33-25N 120-58-10E
14-33-01N 120-57-14E
14-32-04N 120-57-08E
14-32-02N 120-54-12E
14-31-40N 120-54-12E
14-31-41N 120-57-09E
14-31-34N 120-57-35E
14-31-37N 120-58-45E,
BOTOLAN AREA, ZAMBALES
15-16.000663N 120-00.650270E
15-15.099165N 120-00.922251E
15-15.850847N 120-00.945870E
15-15.700160N 120-00.933249E
15-15.523183N 120-00.850559E
15-15.516667N 120-00.650002E,
SAN FELIPE AREA, ZAMBALES
15-03-48N 120-02-34E
15-03-50N 120-02-49E
15-03-57N 120-03-21E

VI NAVIGATIONAL WARNINGS

15-04-21N 120-03-16E
15-04-24N 120-03-20E
15-04-57N 120-03-15E
15-04-57N 120-03-09E
15-05-04N 120-03-08E
15-06-07N 120-02-49E
15-06-32N 120-02-48E
15-06-43N 120-02-18E
15-06-08N 120-02-20E
15-06-07N 120-02-10E
15-05-22N 120-02-19E
15-04-56N 120-02-23E
15-04-30N 120-02-28E
15-04-07N 120-02-31E,
SAN FELIPE AREA, ZAMBALES
15-05-48N 120-02-48E
15-05-43N 120-02-52E
15-05-58N 120-03-02E
15-06-03N 120-03-05E
15-06-03N 120-02-57E
15-06-07N 120-03-01E
15-06-10N 120-03-09E
15-06-13N 120-03-05E
15-06-16N 120-03-13E
15-06-18N 120-03-08E,
SAN FELIPE AREA, ZAMBALES
15-04-42N 120-03-06E
15-04-44N 120-03-19E
15-04-43N 120-03-22E
15-04-43N 120-03-25E
15-04-43N 120-03-26E
15-04-43N 120-03-28E
15-04-42N 120-03-29E
15-04-40N 120-03-32E
15-04-38N 120-03-30E
15-04-41N 120-03-28E
15-04-41N 120-03-27E
15-04-42N 120-03-25E
15-04-41N 120-03-22E
15-04-40N 120-03-19E
15-04-39N 120-03-06E
15-04-36N 120-03-35E
15-04-35N 120-03-34E,
SAN ANTONIO AREA, ZAMBALES
14-56-55N 120-03-12E
14-56-52N 120-03-28E
14-56-47N 120-03-27E
14-56-50N 120-03-11E.
CANCEL THIS MSG 01 JAN 2024.

NAVPHIL 382/22 - LUZON, W. COAST, MANILA BAY AND LUZON SEA - DREDGING OPERATION
CHART 1501, 1502 (INT 4491)
DREDGING OPERATION, SAND EXTRACTION AND RECLAMATION BY MV JINHAIFU 168, MV ZHONGXINGHANG 268 AND MV HONG FU 588 UNTIL 31 DEC 2023 IN AREAS BOUNDED BY:
MANILA PRDP SITE AREA
14-33-33N 120-58-38E
14-33-25N 120-58-10E
14-33-01N 120-57-14E
14-32-04N 120-57-08E
14-32-02N 120-54-12E
14-31-40N 120-54-12E
14-31-41N 120-57-09E
14-31-34N 120-57-34E
14-31-37N 120-58-45E,
BOTOLAN AREA
15-16.00N 120-00.65E
15-15.99N 120-00.92E
15-15.85N 120-00.94E
15-15.70N 120-00.93E
15-15.52N 120-00.85E
15-15.51N 120-00.65E,
SAN FELIPE AREA
15-03-48N 120-02-34E
15-03-57N 120-03-21E
15-04-24N 120-03-20E
15-04-57N 120-03-15E
15-06-32N 120-02-48E
15-06-43N 120-02-18E
15-06-07N 120-02-10E
15-04-07N 120-02-31E,
SAN ANTONIO AREA
14 56-55N 120-03-12E
14 56-52N 120-03-28E
14 56-47N 120-03-27E
14 56-50N 120-03-11E.
CANCEL THIS MESSAGE 01 JAN 2024.

NAVPHIL 004/23 - LUZON W. COAST, MANILA BAY - BATHYMETRIC AND SEISMIC SURVEY
CHART 1501 (INT 4419).
BATHYMETRIC AND SEISMIC SURVEY IN PROGRESS BY MB TRISHA NICOLE, MB KRISTEL, AND MB ST. ANTHONY EXPRESS TO 31 DEC 2023 IN AREAS BOUNDED BY:
PASAY
14-33 33N 120-58 38E
14-33 25N 120-58 10E
14-33 01N 120-57 14E
14-32 04N 120-57 08E
14-32 02N 120-54 12E
14-31 40N 120-54 12E
14-31 41N 120-57 09E
14-31 34N 120-57 35E
14-31 37N 120-58 45E,

VI NAVIGATIONAL WARNINGS

CAVITE
14 18 01N 120-40 32E
14 19 14N 120-39 51E
14 19 39N 120-40 43E
14 19 34N 120-40 44E
14 21 03N 120-43 13E
14 21 03N 120-44 29E
14 20 58N 120-44 43E
14 17 57N 120-41 15E
14 18 00N 120-40 45E.
CANCEL THIS MSG 01 JAN 2024.

**NAVPHIL 016/23 - MINDANAO SE COAST,
PAKIPUTAN STRAIT - GEOTECHNICAL
SURVEY**
CHART 1523.
GEOTECHNICAL SURVEY BY BARGE SY 607
AND MTUG ROSKYIN PROGRESS UNTIL 02
JAN 24 IN AREA BOUNDED BY:
07-06-15N 125-39-03E
07-06-08N 125-39-01E
07-05-54N 125-39-51E
07-06-03N 125-39-52E.
CANCEL THIS MSG 03 JAN 24.

**NAVPHIL 018/23 - LUZON N. COAST, LUZON
STRAIT - CABLE REPAIR**
CHART 4705, 4726A (INT 5050).
CABLE REPAIR BY FOREIGN VESSEL CS
CABLE RETRIEVER UNTIL 25 JAN 23 ALONG
THE TRACK:
19-15.523N 122-26.335E
19-13.326N 122-22.244E
19-13.078N 122-17.268E
19-12.355N 122-13.649E
19-14.773N 122-11.758E
19-11.816N 122-12.215E
19-10.044N 122-07.320E.
CANCEL THIS MSG 26 JAN 24.

**NAVPHIL 032/23 - LUZON W. COAST,
MANILA BAY - BATHYMETRIC SURVEY**
CHART 1501 (INT 4491).
BATHYMETRIC SURVEY BY MB KRISTEL
UNTIL 31 DEC 23 IN AREA BOUNDED BY:
14-20-56N 120-44-41E
14-20-54N 120-45-31E
14-20-47N 120-45-25E
14-20-44N 120-45-09E
14-20-12N 120-44-41E
14-19-60N 120-43-60E
14-19-60N 120-43-35E.
CANCEL THIS MSG 01 JAN 24.

**NAVPHIL 038/23 - LUZON W. COAST, MANILA
BAY - ADDITIONAL VESSELS**
CHART 1501 (INT 4491).
ADDITIONAL VESSELS MV JIN XIONG, MV
XING HANG JUN 1088, MV YI HANG JUN 1068
AND MV JIANG HAI FOR SAND EXTRACTION
ACTIVITY PER NAVPHIL 003/23.
CANCEL THIS MESSAGE 01 JAN 24.

**NAVPHIL 047/23 - LUZON W. COAST, MANILA
BAY - SOIL INVESTIGATION**
CHART 1501 (INT 4491).
SOIL INVESTIGATION WORKS BY VARIOUS
VESSELS UNTIL 31 DEC 23 IN AREA
BOUNDED BY:
14-21-03N 120-43-29E
14-26-14N 120-49-18E
14-26-59N 120-48-37E
14-28-07N 120-51-21E
14-27-11N 120-51-20E
14-26-53N 120-51-01E
14-25-52N 120-49-51E
14-21-03N 120-45-14E.
CANCEL THIS MSG 01 JAN 24.

**NAVPHIL 093/23 - LUZON W. COAST, MANILA
BAY - SCIENTIFIC OPERATIONS**
CHART 1501 (INT 4491).
SCIENTIFIC OPERATIONS IN PROGRESS
UNTIL 31 AUG 23.
BUOY MARKINGS AT 14-33-35N 120-58-07E
AND 14-33-55N 120-57-27E.
CANCEL THIS MSG 01 SEP 23.

**NAVPHIL 110/23 - PHILIPPINE CENTRAL
PART**
CHART 4706 (INT 5051).
CABLE LAYING BY VARIOUS VESSEL IN
PROGRESS UNTIL 30 DEC 23 IN
VICINITY OF LINE JOINING:
A. 12-09.23N 123-55.08E,
12-40.24N 123-52.36E,
13-30.91N 123-01.10E.
B. 08-59.12N 124-48.00E,
09-06.13N 124-44.73E.
CANCEL THIS MSG 31 DEC 2023.

**NAVPHIL 119/23 - LUZON W. COAST, MANILA
BAY AND LUZON SEA - DREDGING AND
LAND DEVELOPMENT OPERATIONS**
CHART 1501 (INT 4491).
DREDGING AND LAND DEVELOPMENT
OPERATIONS IN PROGRESS UNTIL FURTHER
NOTICE IN AREAS BOUNDED BY:
A. 14-44-46N 120-50-14E
14-43-09N 120-52-13E
14-42-49N 120-53-52E
14-42-28N 120-53-44E
14-40-08N 120-49-06E

VI NAVIGATIONAL WARNINGS

14-37-22N 120-45-41E
14-37-34N 120-45-25E
14-41-28N 120-47-21E
14-45-03N 120-48-06E,
B. 14-27-09N 120-43-23E
14-29-06N 120-52-13E
14-26-52N 120-51-47E
14-20-38N 120-45-40E
14-20-46N 120-41-03E
14-26-42N 120-46-07E
14-26-39N 120-43-23E.
C. DISPOSAL SITE 14-20-0N 120-0-0E.

**NAVPHIL 128/23 - PALAWAN NW. COAST.
WEST PHILIPPINE SEA - EXPLORATION
ACTIVITIES**

CHART 1563.

EXPLORATION ACTIVITIES BY SKANDI HAWK
IN PROGRESS UNTIL 01 OCT 23 IN THE AREA
BOUNDED BY:
11-33-03N 118-53-18E
11-34-43N 118-52-19E
11-35-19N 118-53-18E
11-39-00N 118-53-20E
11-38-58N 118-56-53E
11-35-17N 118-56-51E.

CANCEL THIS MSG 02 OCT 23.

**NAVPHIL 130/23 - LUZON W. COAST, MANILA
BAY AND LUZON SEA - DREDGING AND
RECLAMATION**

CHART 1501 (INT 4491).

DREDGING AND RECLAMATION ACTIVITIES
IN PROGRESS IN AREAS BOUNDED BY:
A. 14-34-31N 120-58-17E
14-34-29N 120-58-20E
14-33-00N 120-58-22E
14-33-52N 120-58-26E
14-33-49N 120-58-19E
14-33-53N 120-58-17E
14-33-57N 120-58-13E
14-34-22N 120-58-00E,
B. 14-03-13N 120 37 15E
14-03-27N 120-37-15E
14-03-27N 120-37-26E
14-03-34N 120-37-26E
14-03-34N 120-37-15E
14-03-40N 120-37-15E
14-03-40N 120-37-09E
14-03-13N 120-36-42E.

THIS CANCELS NAVPHIL 084/23.

**NAVPHIL 158/23
LUZON W. COAST.
MANILA BAY AND LUZON SEA.**
CHART 1501(INT 4419).
DREDGING AND RECLAMATION ACTIVITIES
IN PROGRESS IN AREAS
BOUNDED BY:
A. 14-44-46N 120-50-14E
14-43-09N 120-52-13E
14-42-49N 120-53-52E
14-42-28N 120-53-44E
14-40-08N 120-49-06E
14-37-22N 120-45-41E
14-37-34N 120-45-25E
14-41-28N 120-47-21E
14-45-03N 120-48-06E,
B. 14-27-09N 120-43-23E
14-29-06N 120-52-13E
14-26-52N 120-51-47E
14-20-38N 120-45-40E
14-20-46N 120-41-03E
14-26-42N 120-46-07E
14-26-39N 120-43-23E,
C. DISPOSAL AREA 14-20-00N 120-0-00E.
THIS CANCELS NAVPHIL 086/23.

**NAVPHIL 170/23
PANAY NW. COAST.
SIBUYAN SEA.**

CHART 4358, 1544.

CABLE LAYING AND PROTECTION
OPERATIONS IN AREAS BOUNDED BY:
A. 01 AUG TO 31 OCT 23
11-57-01N 121-56-49E
11-57-02N 121-56-51E
11-57-01N 121-56-52E
11-56-54N 121-56-55E
11-56-51N 121-56-58E
11-56-49N 121-56-58E
11-56-45N 121-57-02E
11-56-25N 121-57-06E
11-56-20N 121-57-06E,
B. 01 SEPT TO 31 DEC 23
11-57-01N 121-56-49E
11-57-02N 121-56-51E
11-57-01N 121-56-52E
11-56-54N 121-56-55E
11-56-51N 121-56-58E
11-56-49N 121-56-58E
11-56-48N 121-56-59E
11-56-25N 121-57-05E
11-56-20N 121-57-06E.
CANCEL THIS MESSAGE 01 JAN 24.

VI NAVIGATIONAL WARNINGS

NAVPHIL 172/23

LUZON W. COAST

MANILA BAY.

CHART 1501 (INT 4491).

DREDGING AND RECLAMATION OPERATION

IN PROGRESS AREAS BOUNDED BY:

A. 14-33-52N 120-56-54E

14-33-09N 120-57-24E

14-33-47N 120-58-38E

14-33-58N 120-58-47E

14-34-16N 120-58-47E

14-34-38N 120-58-49E

14-34-57N 120-58-15E,

B. 14-19-29N 120-38-21E

14-19-16N 120-38-09E

14-17-41N 120-38-24E

14-18-00N 120-41-32E

14-21-00N 120-45-29E

14-21-00N 120-44-38E

14-19-36N 120-43-00E,

C. 14-34-20N 120-58-17E

14-33-59N 120-58-19E

14-33-51N 120-58-29E

14-33-48N 120-58-16E

14-33-52N 120-58-14E

14-33-56N 120-58-10E

14-34-13N 120-58-01E.

THIS CANCELS NAVPHIL 003/23, 007/23,

012/23, 035/23, 036/23, 051/23, 129/23.

NAVPHIL 176/23

LUZON N. COAST.

PHILIPPINE SEA.

CHART 2200.

CABLE ROUTE SURVEY IN PROGRESS IN AREAS ALONG THE ROUTE:

A. 21-36.004N 121-50.887E

21-32.449N 121-53.221E

21-28.945N 121-54.538E

21-24.399N 121-58.017E

21-19.809N 121-59.883E

21-13.409N 122-05.469E

21-12.238N 122-06.910E

21-10.450N 122-06.910E

21-12.238N 122-06.910E

21-13.350N 122-08.404E

21-15.914N 122-14.481E

21-20.369N 122-24.969E

21-26.928N 122-46.831E

21-31.345N 123-11.367E

21-31.309N 123-14.610E,

B. 18-36.467N 121-04.028E

18-39.305N 121-04.132E

18-40.963N 121-05.598E

18-41.794N 121-07.932E

18-41.816N 121-12.385E

18-37.363N 121-32.650E

18-42.823N 122-07.453E

18-45.688N 122-18.123E

18-47.780N 122-19.238E

18-48.396N 122-21.280E

18-49.379N 122-31.480E

18-53.449N 122-33.217E

18-59.043N 122-38.843E

19-07.001N 123-01.917E

19-11.704N 123-06.172E

19-19.284N 123-07.144E

19-26.384N 123-11.044E

19-33.728N 123-19.961E

20-01.804N 123-33.832E

20-13.890N 123-33.386E

20-24.615N 123-28.264E

21-07.214N 123-27.999E

21-15.497N 123-25.554E

21-28.753N 123-16.357E,

C. 21-28.753N 123-16.357E

21-31.309N 123-14.610E

21-38.379N 123-21.706E

21-41.147N 123-37.843E

21-39.803N 123-53.887E

21-31.466N 124-00.191E

21-16.435N 124-12.932E

20-56.376N 124-15.945E

20-48.406N 124-22.640E

20-42.968N 124-34.128E

20-05.694N 125-31.635E

19-39.827N 127-00.000E.

WIDE BERTH REQUESTED.

THIS CANCELS NAVPHIL 107/23.

NAVPHIL 183/23

LUZON W. COAST.

MANILA BAY.

CHART 1501 (INT 4491).

DREDGING AND LAND RECLAMATION OPERATIONS IN PROGRESS IN AREAS BOUNDED BY:

A. TEMPORARY EXCLUSION ZONE

14-31-58N 120-53-40E

14-33-34N 120-56-56E

14-33-33N 120-58-08E

14-33-04N 120-58-09E

14-32-08N 120-56-10E,

B. 14-15-18N 120-34-55E

14-16-40N 120-35-40E

14-19-07N 120-37-42E

14-21-03N 120-41-39E

14-21-03N 120-43-13E

14-19-34N 120-40-43E

14-18-47N 120-38-40E

14-14-59N 120-35-31E,

C. 14-20-57N 120-41-44E

14-22-35N 120-42-11E

14-24-19N 120-43-24E

14-25-39N 120-44-33E

14-26-59N 120-45-40E

14-26-59N 120-46-43E,

VI NAVIGATIONAL WARNINGS

D. 14-26-20N 120-41-38E
14-26-59N 120-42-27E
14-26-59N 120-44-41E
14-24-60N 120-42-15E
14-24-60N 120-41-38E.

THIS CANCELS NAVPHIL 103/23, 132/23.

NAVPHIL 214/23

MANILA BAY.

CHART 1501 (INT 4419).

SOIL INVESTIGATION UNTIL 31 OCT 23 IN

AREA BOUNDED BY:

14-35-21N 120-43-39E
14-35-17N 120-44-25E
14-34-50N 120-45-25E
14-34-30N 120-45-28E
14-33-13N 120-45-28E
14-31-00N 120-43-54E
14-32-12N 120-42-50E
14-33-43N 120-43-56E.

CANCEL THIS MESSAGE 01 NOV 23.

NAVPHIL 216/23

MINDORO SW. COAST

APO EAST PASS.

CHART 1552.

SAND EXTRACTION OPERATIONS UNTIL 22

SEPT 23 IN AREA BOUNDED BY:

12-44-17N 120-47-38E
12-43-58N 120-47-49E
12-43-42N 120-47-19E
12-44-24N 120-46-53E.

CANCEL THIS MSG 23 SEPT 23.

NAVPHIL 225/23

CENTRAL LUZON.

LAGUNA DE BAY.

CHART 4230.

HYDROGRAPHIC SURVEY AND SUBMARINE PIPE LAYING COMENCING ON 10 JUL 23 UNTIL FURTHER NOTICE IN AREA BOUNDED BY:

14-31-27N 121-05-50E
14-31-06N 121-06-37E
14-30-37N 121-07-08E
14-27-43N 121-08-57E
14-25-40N 121-10-15E
14-25-35N 121-10-38E
14-25-47N 121-10-58E
14-25-56N 121-11-10E
14-26-02N 121-11-28E
14-26-03N 121-11-38E
14-26-07N 121-11-52E
14-26-09N 121-12-02E
14-25-52N 121-12-44E
14-25-47N 121-12-42E
14-26-04N 121-12-02E
14-26-03N 121-11-53E
14-25-58N 121-11-40E

14-25-57N 121-11-29E
14-25-52N 121-11-12E
14-25-43N 121-11-01E
14-25-30N 121-10-39E
14-25-36N 121-10-12E
14-27-41N 121-08-53E
14-30-34N 121-07-04E
14-31-02N 121-06-34E
14-31-23N 121-05-48E.

CANCEL THIS MSG 11 JUL 24.

NAVPHIL 237/23 LUZON W. COAST. MANILA BAY. CHART 1501(INT 4491).

SILT DISPOSAL OPERATIONS UNTIL 30 OCT IN AREA BOUNDED BY:

14-34-52N 120-47-05E
14-34-52N 120-47-09E
14-34-40N 120-47-05E
14-34-40N 120-47-19E
14-34-42N 120-47-12E.

CANCEL THIS MESSAGE 31 OCT 23.

NAVPHIL 238/23

WEST PHILIPPINE SEA.

CHART 2200.

CABLE REPAIR OPERATIONS ON 11 AUG TO 10 OCT ALONG THE ROUTE:

21-30.0N 125-34.1E
21-22.8N 125-10.2E
21-09.2N 124-50.5E
20-59.1N 124-29.6E
20-46.6N 124-08.7E
20-47.4N 123-17.8E
20-09.8N 122-06.4E
19-51.2N 121-51.7E
19-33.7N 120-07.4E
19-13.2N 119-54.4E
18-10.9N 119-17.1E
17-48.1N 119-11.8E
17-02.9N 119-23.0E
16-39.8N 119-21.2E
15-56.4N 119-15.1E
15-23.5N 119-24.9E
14-00.4N 120-19.0E.

CANCEL THIS MESSAGE 11 OCT 23.

NAVPHIL 251/23

LUZON SW. COAST.

APO EAST PASS.

CHART 1552.

DREDGING ACTIVITY IN PROGRESS IN AREA BOUNDED BY:

12-30-40N 120-55-48E
12-30-33N 120-55-37E
12-30-34N 120-55-32E
12-30-45N 120-55-31E
12-30-45N 120-55-16E
12-30-07N 120-55-19E
12-30-08N 120-55-36E

VI NAVIGATIONAL WARNINGS

12-30-19N 120-55-31E
12-30-24N 120-55-43E
12-30-32N 120-55-52E.

NAVPHIL 260/23
LUZON W. COAST.
SUBIC BAY.
CHART 1501 (INT 4491).
SAND LOADING OPERATION IN PROGRESS
FROM
14-51-32N 120-12-19E TO 14-49-02N 120-17-
37E.

NAVPHIL 263/23
LUZON W. COAST.
MANILA BAY AND LUZON SEA.
CHART 1501,1502 (INT 4491).
DREDGING AND RECLAMATION OPERATIONS
IN PROGRESS IN AREA BOUNDED BY:
MANILA BAY
14-33-33N 120-58-38E
14-33-25N 120-58-10E
14-33-01N 120-57-14E
14-32-04N 120-57-08E
14-32-02N 120-54-12E
14-31-40N 120-54-12E
14-31-41N 120-57-09E
14-31-34N 120-57-35E
14-31-37N 120-58-45E,
SAND EXTRACTION OPERATIONS IN
PROGRESS IN AREAS BOUNDED BY:
BOTOLAN
15-16.00N 120-00.65E
15-15.10N 120-00.92E
15-15.85N 120-00.95E
15-15.70N 120-00.93E
15-15.52N 120-00.85E
15-15.52N 120-00.65E,
SAN FELIPE
15-03-48N 120-02-34E
15-03-57N 120-03-21E
15-04-24N 120-03-20E
15-04-57N 120-03-15E
15-06-32N 120-02-48E
15-06-43N 120-02-18E
15-06-07N 120-02-10E
15-04-07N 120-02-31E,
SAN FELIPE
15-05-48N 120-02-48E
15-05-43N 120-02-52E
15-06-16N 120-03-13E
15-06-18N 120-03-08E,
SAN ANTONIO
14-56-55N 120-03-12E
14-56-52N 120-03-28E
14-56-47N 120-03-27E
14-56-50N 120-03-11E.
THIS CANCELS NAVPHIL 023/23, 114/23.

NAVPHIL 268/23
PALAWAN NW. COAST.
WEST PHILIPPINE SEA.
CHART 1562.
GUNNERY EXERCISE ON 15 TO 31 AUG IN
AREA BOUNDED BY:
10-08-30N 118-33-00E
10-08-30N 118-27-06E
10-13-36N 118-27-06E
10-13-36N 118-33-00E.
CANCEL THIS MESSAGE 01 SEP 23.

NAVPHIL 269/23
LUZON W. COAST.
LUZON SEA.
CHART 1501 (INT 4491).
GUNNERY EXERCISE ON 29 SEPT IN AREA
BOUNDED BY:
14-21-00N 120-10-00E
14-15-00N 120-10-00E
14-15-00N 120-16-00E
14-21-00N 120-16-00E.
CANCEL THIS MESSAGE 30 SEPT 23.

NAVPHIL 271/23
PALAWAN SE. COAST.
SULU SEA.
CHART 4707 (INT 5052).
GUNNERY EXERCISE IN AREAS BOUNDED
BY:
A. 25 TO 31 AUG
09-35-24N 118-54-58ENAVPHIL 279/23
PALAWAN NW. COAST.
WEST PHILIPPINE SEA.
CHART 1563.
GUNNERY EXERCISE ON 28 AUG UNTIL 01
SEPT IN AREA BOUNDED BY:
11-08-47N 118-58-36E
11-08-47N 119-06-47E
11-00-47N 119-06-47E
11-00-47N 118-58-36E.
CANCEL THIS MESSAGE 02 SEPT 23.
09-28-29N 118-54-57E
09-28-29N 119-02-24E
09-35-24N 119-02-00E,
B. 24 TO 29 AUG
09-36-01N 118-51-08E
09-36-02N 118-57-01E
09-30-21N 118-57-04E
09-30-08N 118-51-03E.
CANCEL THIS MESSAGE 30 AUG 23.

VI

NAVIGATIONAL WARNINGS

NAVPHIL 273/23**KALAYAAN ISLAND GROUP.****WEST PHILIPPINE SEA.**

CHART 4723B.

GUNNERY EXERCISE AND NO SAIL ZONE ON
0800H TO 2100H 23 AUG OR ON ALTERNATE
SCHEDULE 28 AUG IN AREA BOUNDED BY:
10-24-47N 114-17-52E
10-25-17N 114-25-48E
10-18-57N 114-26-05E
10-18-14N 114-18-34E.

HAZARD SPACE COVERS 5NM RADIUS
AROUND 10-22-41N 114-21-49E.

CANCEL THIS MESSAGE 2200H 28 AUG 23.

NAVPHIL 274/23**SAMAR N. COAST.****CAPUL PASS.**

CHART 1515.

SUBMARINE CABLE REPAIR BY CS VEGA,
1706 TONS, ON 21 AUG UNTIL 10 SEPT AT 12-
25-09N 124-12-46E. WIDE BERTH
REQUESTED.

CANCEL THIS MESSAGE 11 SEPT 23.

NAVPHIL 276/23**SAMAR E. COAST, PHILIPPINE SEA.****SPACE DEDRIS 24 AUG TO 01 SEPT**

AREA BOUNDED BY:

14-54-10N 128-40-06E
11-19-18N 129-10-50E
11-26-49N 129-54-08E
15-01-42N 129-24-03E.

CANCEL THIS MSG 02 SEPT 23.

NAVPHIL 278/23**MINDANAO SW. COAST.****SULU SEA.**

CHART 1528.

GUNNERY EXERCISE ON 28 AUG TO 01 SEPT
IN AREA BOUNDED BY:
07-02-06N 121-42-25E
07-01-56N 121-37-24E
06-56-53N 121-37-29E
06-56-53N 121-42-23E.
CANCEL THIS MESSAGE 02 SEPT 23.

NAVPHIL 281/23**LUZON W. COAST.****LUZON SEA.**

GUNNERY EXERCISE ON 28 AUG UNTIL 01
SEPT IN AREA CHART 1501(INT 4491).

BOUNDED BY:

14-35-30N 120-05-00E
14-25-30N 120-05-00E
14-25-00N 119-54-30E
14-35-00N 119-54-30E

CANCEL THIS MESSAGE 02 SEPT 23.

VII

PUBLICATION NOTICES

1. There is no publication notice for this month.
2. Mariners are requested to notify the Hydrography Branch, NAMRIA of any changes or discrepancies found on Nautical charts and Nautical publications issued by this office, especially if this affects navigational safety in Philippine Waters. The reported information may be sent using the Hydrographic Note or the Hydrographic Note for Port Information, which are on the succeeding pages.

Reports may be sent through the following means:

Mail: NAMRIA - Hydrography Branch, 421 Barraca St San Nicolas, Manila 1010
Email: maritime.affairs@namria.gov.ph and maritime.concerns@gmail.com
Fax: (+632) 8242-2955
Onsite: <http://namria.gov.ph/omsis/HNote10.aspx>



HYDROGRAPHIC NOTE

NAMRIA-HNC-Form10 Rev01

SENDER INFORMATION

Reference Number			<input type="checkbox"/> Tick box if not willing to be named as source of this information	
Name of ship or sender				
	Name	Signature	IMO Number	Date
Address of sender				
E-mail Address			Telephone/ Mobile No.	

INSTRUCTIONS (At the back)

Subject			
General Locality			
Position:	Latitude	Longitude	
Position fixing system used		Datum	
Charts affected		Edition	
ENCs affected			
Latest Notice to Mariners held			
Nautical Publications affected (Edition No.)			
Details of anomaly or observation			

A replacement copy of Chart No. _____ is required (see Instruction 4).

INSTRUCTIONS

1. Mariners are requested to notify the Hydrography Branch of the National Mapping and Resource Information Authority (NAMRIA) when new or suspected dangers to navigation are discovered, changes observed in aids to navigation, or corrections to publications that are seen to be necessary. Mariners can also report any ENC display issues experienced.
2. This form and its instructions have been designed to help both the sender and the recipient. It should be used, or followed, closely, whenever appropriate. Copies of this form may be obtained gratis from the Hydrography Branch at 421 Barraca St., San Nicolas, Manila, or by requesting thru email at maritime.affairs@namria.gov.ph.
3. **Position:** When a position is defined by sextant angles or bearings (true or magnetic being specified) more than two should be used in order to provide a check. Distances observed by radar should be quoted. However, when there is a series of fixes along a ship's course, only the method of fixing and the objects used need to be indicated. Latitude and longitude should only be used specifically to position the details when they have been fixed by astronomical observations or GPS and a full description of the method, equipment and datum used should be given.
4. **Paper Charts:** A cutting from the largest scale paper chart is the best medium for forwarding details, the alterations and additions being shown thereon in red. When requested, a new copy will be sent in replacement of a chart that has been used to forward information, or when extensive observations have involved defacement of the observer's chart. If it is preferred to show the amendments on a tracing of the largest scale chart (rather than the chart itself) these should be in red as above, but adequate detail from the chart must be traced in black ink to enable the amendments to be fitted correctly.
5. **Electronic Navigational Charts (ENCs):** A screen grab of the largest scale usage band ENC with the alterations and additions being shown thereon in red.
6. **Soundings:** When soundings are obtained, it is important to ensure that full details of the method of collection are included in this report. This include but no limited to:
 - a. Make, model, and type of echo sounder used.
 - b. Whether the echo sounder is set to register depths below the surface or below the keel; in the latter case the vessel's draught should be given.
 - c. Time, date and time zone should be given in order that corrections for the height of the tide may be made where necessary, or a statement made as to what corrections for tide have already been made.
 - d. Where larger amounts of bathymetric data have been gathered, only those areas where a significant difference to the current chart or ENC should be specifically mentioned on the H102. The full data set may also be sent in, with an additional note added to this effect. If no

significant differences are noted, the bathymetric data may still be of use, and sent in accordingly. Where full data sets are included, a note as to the data owner and their willingness for the data to be incorporated into charts and ENCs included.

5. **For Echo Sounders that use electronic 'range gating',** care should be taken that the correct range scale and appropriate gate width are in use. Older electro-mechanical echo sounders frequently record signals from echoes received back after one or more rotations of the stylus have been completed. Thus, with a set whose maximum range is 500m, an echo recorded at 50m may be from depths of 50m, 550m or even 1050m. Soundings recorded beyond the set's nominal range can usually be recognized by the following:
 - a. the trace being weaker than normal for the depth recorded;
 - b. the trace passing through the transmission line;
 - c. the feathery nature of the trace.
- As a check that apparently shoal soundings are not due to echoes received beyond the set's nominal range, soundings should be continued until reasonable agreement with charted soundings is reached. However, soundings received after one or more rotations of the stylus can still be useful and should be submitted if they show significant differences from charted depths.
6. **Reports which cannot be confirmed or are lacking in certain details should not be withheld.** Shortcomings should be stressed and any firm expectation of being able to check the information on a succeeding voyage should be mentioned.
7. Changes to Port Information should be forwarded using Hydrographic Note for Port Information. Where there is insufficient space on the forms additional sheets should be used.
8. Reports using this form and relevant data should be sent either through mail at NAMRIA-Hydrography Branch, 421 Barraca St., San Nicolas, Manila or through email at maritime.affairs@namria.gov.com and maritime.concerns@gmail.com.

An acknowledgement or receipt will be sent and the information then used to the best advantage which may mean immediate action or inclusion in a revision in due course; for these purposes, the UKHO may make reproductions of any material supplied. When a Notice to Mariners is issued, the sender's ship or name is quoted as authority unless (as sometimes happens) the information is also received from other authorities or the sender states that they do not want to be named by using the appropriate tick box on the form. An explanation of the use made of contributions from all parts of the world would be too great a task and a further communication should only be expected when the information is of outstanding value or has unusual features.



HYDROGRAPHIC NOTE FOR PORT INFORMATION

NAMRIA-HNC-Form11 Rev01

Page ____ of ____

NOTES

1. This form lists the information required for Philippine Coast Pilot and has been designed to help the sender and the recipient. The sections should be used as an aide-memoir, being used or followed closely, whenever appropriate. Where there is insufficient space on the form an additional sheet should be used.
2. **Reports which cannot be confirmed or are lacking in certain details should Not be withheld.** Shortcomings should be stressed and any firm expectation of being able to check the information on a succeeding voyage should be mentioned.
3. **DATA PRIVACY STATEMENT:** NAMRIA values your right to data privacy. We are committed to be faithful stewards in safeguarding your personal and sensitive information under the Data Privacy Act of 2012 (RA 10173). We ask for your personal information and email addresses on our Hydrographic Notes so we can confirm receiving the Note. We do Not use your information in any way other than in the furtherance of our vision and mission as Philippines Hydrographic Office.

Reference Number

(to be filled out by NAMRIA personnel)

OBSERVER/REPORTER INFORMATION

		<input type="checkbox"/> Tick box if not willing to be Named as source of this information	
Name of Observer/Reporter		Signature	
Name of ship or Office		IMO Number	Date
Address of sender			
E-mail Address	Telephone/ Mobile No.		

Name of Port			
Approximate Position	Latitude	Longitude	
Port Authority Name and contact details			
General Remarks <ul style="list-style-type: none">• Principal activities and trade.• Latest population figures and date.• Number of ships or tonnage handled per year.• Maximum size of vessel handled.• Copy of Port Handbook (<i>if available</i>).			
Berthing Facility <ul style="list-style-type: none">• Type (L-pier, T-pier, wharf, etc.)• Names, Numbers or positions & lengths.• Depths alongside.			
Storage Facility <ul style="list-style-type: none">• Area of open storage area and warehouse• Existence of reefer facilities, cold storage, and special storage facilities.			
Anchorages Position, designation, depths, holding ground, shelter afforded.			
Pilotage <ul style="list-style-type: none">• Authority for requests.• Pilot boarding position.• Regulations (compulsory or not).• Name of pilot association and contact details.			



HYDROGRAPHIC NOTE FOR PORT INFORMATION

NAMRIA-HNC-Form11 Rev01

Page ____ of ____

Tugs <ul style="list-style-type: none">• Number available.• Name of tug operator and contact details	
Directions <ul style="list-style-type: none">• Entry and berthing information.• Tidal streams.• Navigational aids.	
Small Craft Facility Name of yacht club, contact No email address.	
Cargo Handling Containers, lighters, Ro-Ro etc.	
Repairs <ul style="list-style-type: none">• Hull, machinery and underwater.• Shipyards.• Docking or slipping facilities.• <i>(Give size of vessels handled or dimensions)</i>• Divers.	
Rescue and Distress <ul style="list-style-type: none">• Salvage, Lifeboat, Coastguard, etc.• Name of Nearest Coast Guard station and contact details.	
Supplies <ul style="list-style-type: none">• Fuel (with type, quantities and methods of delivery)• Fresh water (with method of delivery and rate of supply)• Provisions.	
Services <ul style="list-style-type: none">• Medical.• Ship Sanitation.• Garbage and slops.• Ship chandlery, tank cleaning, compass adjustment, hull painting.	
Communications <ul style="list-style-type: none">• Nearest airport or airfield.• Port radio and information service. (with frequencies and hours of operating)	
Government Services <ul style="list-style-type: none">• Customs• Quarantine• Plant and Animal Quarantine• Immigration	
Local Situation <ul style="list-style-type: none">• Health facilities (nearest hospitals, clinics, health centers)• Banks and money remittance facilities	
Views Photographs (where permitted) of the approaches, leading marks, the entrance to the harbour etc.	
Additional Details:	

Nautical Charts, Topographic Maps, Tide and Current Tables, and related publications are available for sale at the NAMRIA Map Sales Offices (MSO):

METRO MANILA:

NAMRIA Main Office MSO

Fort Andres Bonifacio, Taguig City
Contact Nos. (02) 8810-4831 to 42 local 431,
(02) 8810-5467

Manila MSO

Hydrography Branch
421 Barraca Street, San Nicolas, Manila
Contact Nos. (02) 8241-3494 local 117,
(02) 8245-9498, 0966-8523814

DENR Central Office MSO

Forest Management Bureau (FMB) Building
Visayas Avenue, Quezon City
Contact Nos. (02) 8925-1157,
0999-6079193, 0928-4497159

REGION I:

San Fernando (La Union) MSO

DENR Government Center
Sevilla, San Fernando City
Contact Nos. 0961-4552526, 0917-1885162

REGION II: (TEMPORARY CLOSED)

Cagayan MSO

DENR – LEP, Building II
Carig, Tuguegarao City
Contact Nos. 0999-309-3702

REGION III:

Pampanga MSO

DENR Compound, Diosdado Macapagal Gov't.
Center, Maimpis City, San Fernando City,
Pampanga
Contact Nos. 0917-8980403

REGION IV-A:

Southern Tagalog MSO

Provincial Planning and Development Office
Laurel Park, Capitol Site, Batangas City
Contact Nos. 0961-4552583

REGION IV-B:

Puerto Princesa MSO

DENR-PENRO Compound,
Brgy. Santa Monica, Puerto Princesa City
Contact Nos. 0916-2038041

REGION V:

Legazpi City MSO

DENR-Operation/Survey Division,
Rizal St Sagpon, Legazpi City
Contact Nos. (052) 480-9825, 0919-8944613

REGION VI:

Iloilo City MSO

Manuel Lagunilla Bldg,
DENR Compound, Parola, Iloilo City
Contact Nos. 0919-887-3862,

REGION VII:

Cebu City MSO

G/F DENR-CENRO Building
Arellano Blvd corner. V. Sotto St. Pier 3,
Cebu City
Contact Nos. 0922-791-0372, 0961-455-2579,
09310010341

REGION VIII: (Temporary Closed)

Tacloban City MSO

DENR Compound, Sto. Niño Extension,
Tacloban City
Contact Nos. (053) 325-6223, (053) 321-3386,
0921-3628489

REGION IX:

Zamboanga City MSO

DENR CENRO West
General Vicente Alvarez St Zone 4,
Zamboanga City
Contact Nos. 0955-8928777, 0961-4552574

Zamboanga del Sur MSO

Pres. Corazon C. Aquino Regional Government,
Center, Balintawak, Pagadian City,
Zamboanga del Sur
Contact Nos. 0935-5962917

REGION X:

Cagayan de Oro City MSO

DENR Building Macabalan,
Macabalan (Puntod), Cagayan de Oro City
Contact Nos. 0966-8524887

REGION XI:

Davao City MSO

Kilometer 7, SPED Road, Bangkal,
Davao City
Contact Nos. 0915-612-7770, 0966-8523825

REGION XII:

Koronadal City MSO

DENR Region 12, Land Evaluation Party Ofice,
Aurora Street, Koronadal City, South Cotabato
Contact Nos. 0909-9324745

CARAGA Administrative Region:

CARAGA MSO

DENR Land Management Services Bldg.,
Ambago, Butuan City, Agusan del Norte
Contact Nos. 0948-3619452